



CTA10 Feed to Length Operator Interface for DKC

Application Manual

Title	CTA10 Feed to Length Operator Interface for DKC
Type of Documentation	Application Manual
Document Typecode	DOK-SUPPL*-CTA10*R****-AW04-AE-P
Internal File Reference	Document Number, 120-2100-B310-04/AE
Purpose of Documentation	This documentation describes the CTA10 Feed to Length control. It contains descriptions of the data screens and the logic required for its application.

Record of Revisions

Description	Release Date	Notes
01	12/96	First Edition, supports CTA10*DK1-01VRS
02	02/97	Updated to support CTA10*DK1-02VRS
03	07/99	Updated to support CTA10*DK1-03VRS (includes ECODRIVE03)
04	03/03	Updated to support CTA10*DK1-04VRS

Copyright	© 2003 Bosch Rexroth AG Copying this document, giving it to others and the use or communication of the contents thereof without express authority, are forbidden. Offenders are liable for the payment of damages. All rights are reserved in the event of the grant of a patent or the registration of a utility model or design (DIN 34-1).
Validity	The specified data is for product description purposes only and may not be deemed to be guaranteed unless expressly confirmed in the contract. All rights are reserved with respect to the content of this documentation and the availability of the product.
Published by	Bosch Rexroth AG Bgm.-Dr.-Nebel-Str. 2 • D-97816 Lohr a. Main • Germany Tel.: +49 (0)93 52/40-0 • Fax: +49 (0)93 52/40-48 85 • Telex: 68 94 21 Bosch Rexroth Corporation • Electric Drives and Controls 5150 Prairie Stone Parkway • Hoffman Estates, IL 60192 • USA Tel.: 847-645-3600 • Fax: 847-645-6201 http://www.boschrexroth.com/ Dept. ESG4 (DPJ)
Note	This document has been printed on chlorine-free bleached paper.

Table of Contents

1	General Description	1-1
1.1	CTA10/DKC Interface	1-1
	CTA 10 Firmware Versions.....	1-1
	ECODRIVE Documentation.....	1-2
	DK1-04VRS Firmware Features	1-3
	DK1-03VRS Firmware Features	1-3
1.2	Roll-Feed Press Configuration.....	1-5
1.3	Keyboard Functions	1-5
2	CTA10 Display	2-1
2.1	Display Overview	2-1
2.2	Main Display.....	2-1
2.3	Part Edit Display (F1)	2-1
2.4	Part Select Display (F2)	2-2
2.5	System Totals Display (F3)	2-2
	Press Permissive Interface (F3)	2-3
2.6	System Data Display (F4)	2-8
	System Inputs (F1).....	2-8
	System Outputs (F2).....	2-8
	Versions (F3)	2-8
2.7	Drive Status (F5)	2-8
3	CTA10 Parameter Mode Display	3-1
3.1	Display Overview	3-1
3.2	Main Parameter Mode Display (ESC).....	3-1
3.3	Part Data Display (F1).....	3-1
3.4	Drive Data Display (F2).....	3-2
	DKC Parameter Display (F1)	3-2
	Archive Display (F2).....	3-2
	Restore Display (F3)	3-3
	Load Default (F4)	3-3
	Measure Wheel (F4)	3-3
3.5	System Data (F3)	3-4
3.6	System Inputs Display (F4)	3-5
3.7	Drive Status Display (F5)	3-5
4	CTA10 Input/Output System	4-1
4.1	CTA10 Inputs	4-1
4.2	CTA10 Outputs	4-1
4.3	Emergency Stop.....	4-2

5	CTA10 Modes	5-1
5.1	Overview	5-1
5.2	Parameter Mode	5-1
5.3	Initialization Mode	5-1
5.4	Manual Mode	5-1
5.5	Automatic Mode	5-1
6	CTA10 Diagnostics	6-1
6.1	Overview	6-1
6.2	System Status	6-1
	Parameter Mode Status Text	6-1
	Initialization Status Text	6-1
	Manual Mode Status Text	6-1
	Automatic Mode Status Text	6-2
	Drive Warnings	6-2
6.3	System Faults	6-3
	Hard Faults	6-3
	Soft Faults	6-3
6.4	Firmware Errors (Troubleshooting)	6-4
7	Drawings	7-1
7.1	CTA10 - DKC 1.1 Interconnect	7-1
7.2	CTA10 - DKC 1.3 Interconnect	7-2
7.3	CTA10 - DKC 1.3-016A Interconnect	7-3
7.4	CTA10 - Layout and Dimensions	7-4
8	Index	8-1
9	Service & Support	9-1
9.1	Helpdesk	9-1
9.2	Service-Hotline	9-1
9.3	Internet	9-1
9.4	Vor der Kontaktaufnahme... - Before contacting us	9-1
9.5	Kundenbetreuungsstellen - Sales & Service Facilities	9-2

1 General Description

1.1 CTA10/DKC Interface

The Bosch Rexroth CTA10 is an operator interface for the DKC01.1 and DKC01.3 drive controllers, using DK1 Roll Feed firmware. It controls the feeding of materials such as metal, foil or film through a shear, punch press, or a similar stamping machine.

The machine builder or user enters data into the DKC parameters (via the CTA10) to specify the mechanical and operating characteristics of the system. The system is designed to ensure operating integrity and safety, using various inputs and outputs (I/O) to assure that the feeder and its subsequent processing station or device operates in harmony. A diagnostic system monitors I/O and operating conditions and stops the system if a fault is detected. Diagnostic messages are displayed to aid the operator in troubleshooting problems.

CTA 10 Firmware Versions

The following CTA10 DK1 firmware versions are available for roll feed applications:

CTA10 Firmware	Description
FWA-CTA10*-DK1-03VRS	Supports ECODRIVE01 (DKC01.1) and ECODRIVE 03 (DKC01.3) 40A, 100A and 200A units. Serial communication via RS485 only
FWA-CTA10*-DK1-04VRS	Supports ECODRIVE03 (DKC01.3) 16A, 40A, 100A and 200A units. Serial communication via RS232 only

Table 1-1: CTA10 DK1 Roll Feed Firmware Versions

Note: CTA firmware version DK1-03VRS and DK1-04VRS are identical with the exception of the serial communication interface support.

ECODRIVE Documentation

This manual contains only CTA10-specific information for DKC drive controllers using DK1 Roll Feed firmware.

ECODRIVE01 Documentation

Refer to the following manuals for detailed information about DKC01.1 parameters and general functionality.

Description	Typecode	Material No.
ECODRIVE DKC combined with MKD Selection Lists	DOK-ECODRV-DKC+MKD****-AUS1-MS-P	261599
ECODRIVE DKC01.1/DKC11.1 Drive Controllers Project Planning Manual	DOK-ECODRV-DKC01/11.1*-PRJ3-EN-P	270950
ECODRIVE DKC1 ASE-04 Functional Description	DOK-ECODRV-ASE-04VRS**-FKB1-EN-P	275270
ECODRIVE DKC1-ASE-04 Troubleshooting Guide	DOK-ECODRV-ASE-04VRS**-WAR1-EN-P	275271
ECODRIVE DKC1-ASE04 Version Notes	DOK-ECODRV-ASE-04VRS**-FVN1-EN-P	275272
ECODRIVE DKC3 PDP--03 Functional Description	DOK-ECODRV-PDP-03VRS**-FKB1-EN-P	274132
ECODRIVE DKC3 PDP03 Troubleshooting Guide	DOK-ECODRV-PDP-03VRS**-WAR1-EN-P	274133

Table 1-2: DKC01.1 Documentation

ECODRIVE03 Documentation

Refer to the following manuals for detailed information about DKC01.3 parameters and general functionality.

Description	Typecode	Material No.
ECODRIVE03 Drive Controllers Project Planning Manual	DOK-ECODR3-DKC**.3****-PR05-EN-P	280107
ECODRIVE03 SERCOS Interface for General Automation SGP-01 Functional Description	DOK-ECODR3-SGP-01VRS**-FKB1-EN-P	279095
ECODRIVE03 SERCOS Interface for General Automation SGP-01 Troubleshooting Guide	DOK-ECODR3-SGP-01VRS**-WAR1-EN-P	279096
ECODRIVE03 SERCOS Interface for General Automation SGP-01 Firmware Version Notes	DOK-ECODR3-SGP-01VRS**-FVN1-EN-P	280282
ECODRIVE03 SERCOS Interface for General Automation SGP-01 Parameter Description	DOK-ECODR3-SGP-01VRS**-PAR1-EN-P	283218
ECODRIVE03 SERCOS Interface for General Automation SGP-03 Functional Description	DOK-ECODR3-SGP-03VRS**-FK01-EN-P	295671
ECODRIVE03 SERCOS Interface for General Automation SGP-03 Parameter Description	DOK-ECODR3-SGP-03VRS**-PA01-EN-P	295673
ECODRIVE03 SERCOS Interface for General Automation SGP-03 Troubleshooting Guide	DOK-ECODR3-SGP-03VRS**-WA01-EN-P	295675
ECODRIVE03 SERCOS Interface for General Automation SGP-03 Firmware Version Notes	DOK-ECODR3-SGP-03VRS**-FV01-EN-P	295677

Table 1-3: Ecodrive03 Documentation

DK1-04VRS Firmware Features

The firmware features of DK1-03VRS and DK1-04VRS are identical with the exception of the serial communication interface support. CTA10 firmware version DK1-04VRS was designed in support of the DKC01.3-16A unit which only communicates via RS232. The DKC01.3 (40A, 100A and 200A) units can communicate via RS232 or RS485.

- DK1-03VRS supports only RS485
- DK1-04VRS supports only RS232

Note: Refer to the connection diagrams in chapter 7 for details.

DK1-03VRS Firmware Features

Note: ECODRIVE03 is the next generation in the ECODRIVE drive family (DKC drives), which has additional features and an increased power range. Please note that some of the new features in version 03VRS of the DK1 Roll Feed Firmware are supported only for ECODRIVE03.

Version 03VRS of the DK1 Roll Feed Firmware supports the following features:

- support of the ECODRIVE03 drive family, with firmware version SGP01V13 or higher
- measuring wheel support
- new system parameters:
 - measuring wheel on/off
 - configurable analog feedrate override for automatic mode (ECODRIVE03 only)
- faster baud rate (ECODRIVE03 only): 38,400 kbps
- support of the eight languages (ECODRIVE01 and ECODRIVE03):

- Czechoslovakian	- English
- French	- German
- Italian	- Portuguese
- Spanish	- Swedish

Note: For the ECODRIVE03 only:
Upon each startup, the CTA10 maps the I/O on the DKC 1.3, as shown in *Fig. 7-2: CTA10 - DKC1.3 Interconnect*. Any unused I/O cannot be mapped.

Description of Features in Version 03VRS Roll Feed Firmware

Measuring Wheel (ECODRIVE03 only)

To compensate for the slip between the motor-driven roll feed and the sheet material, the position measurement can be performed with an additional measuring wheel instead of with the motor encoder. The torque to turn the measuring wheel is very low, so the slip is negligible. The measuring wheel must remain in constant contact with the sheet material or the position control loop will not be properly closed. If such constant contact is not possible, the position feedback must be switched back to the motor encoder.

Pin 5 on X15 is the digital input to switch the measuring wheel format on (24 V) or off (0 V). The status of this input is written to Parameter P-0-220, bit 1 (see table below).

Power to X15, pin 5	Digital value written to P-0-220, bit 1	Result
24V	1	measuring wheel active (position feedback from measuring wheel)
0V	0	measuring wheel inactive (position feedback from motor encoder)

Table 1-4: Power to X5

To use the measuring wheel function, the following parameters must be set. Refer to the appropriate ECODRIVE03 Functional Description manual for information regarding the setting of these parameters.

DKC Parameter #	Description
P-0-0075	Feedback 2 type
P-0-0121	Velocity mix factor feedback (0%) (<i>in development</i>)
P-0-0221	Measuring wheel filter time constant
S-0-0115	Position feedback type / direction (rotary or linear)
S-0-0117	Feedback 2 resolution (in mm or revolutions)
S-0-0123	Measuring wheel feed constant
S-0-0391	Monitoring window feedback (0 necessary)

Table 1-5: Measuring Wheel-Related DKC Parameters

Analog Feedrate Override

In any DKC drive, the system parameter "Analog Feedrate Override" can be set to provide an analog feedrate override signal to the drive, which will influence the drive velocity.

The standard scaling is that 10V are equivalent to the nominal or programmed velocity. 0V analog feedrate override causes a velocity of 0.

Using drive parameter P-0-0214, the scaling of the analog input voltage can be set (default = 3000). This parameter appears in the DKC parameter list.

1.2 Roll-Feed Press Configuration

The CTA10 is capable of storing up to 105 part configurations in the FLASH EPROM. Each part can have a separate length, rate, velocity, acceleration and jerk. The operator selects the active part from the CTA10 interface. A new part can become active at any time, but only the length and speed data can be altered by the operator outside of parameter mode. The CTA10 contains various system performance data and accumulators. It tracks the strokes per minute, time used, total length fed and total number of pieces run. It also has a part counter to allow simple batching.

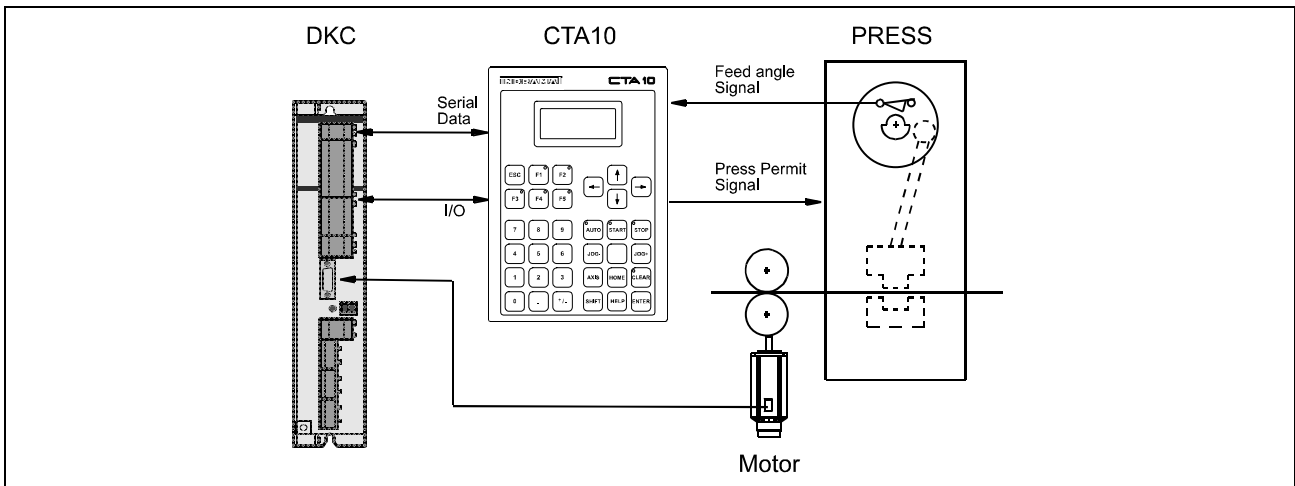


Fig. 1-1: Configuration of a Roll-Feed Press

1.3 Keyboard Functions

Note: For function keys F1-F5, the LED lights up when the key has been configured to perform a special function.

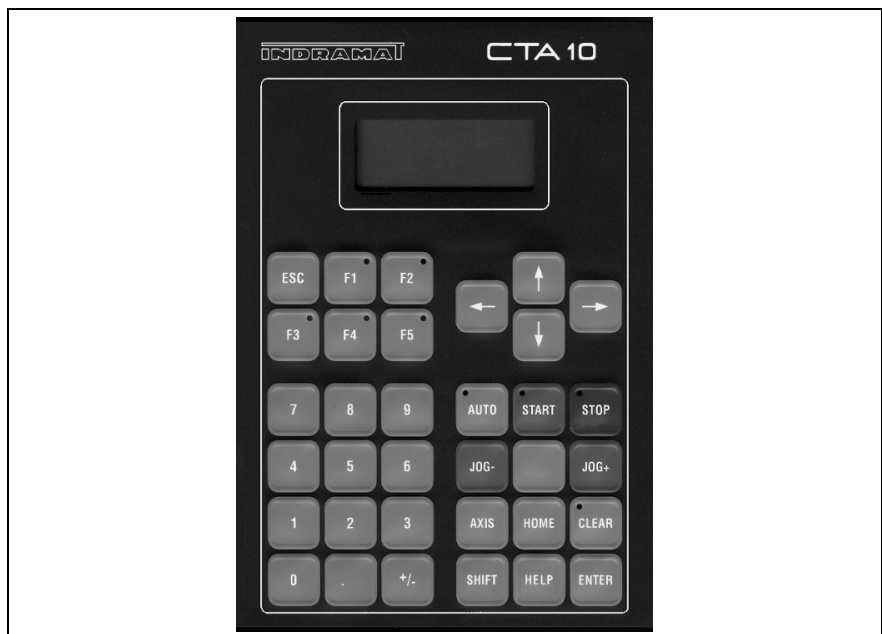


Fig. 1-2: CTA10 Keyboard and Display

AUTO: Pressing this key while in manual mode will place the CTA10 in automatic mode. The LED will turn on indicating that it is in automatic mode. Pressing the key while in automatic mode will return the CTA10 to manual mode providing that the feeder is not cycling. If the feeder is cycling, press STOP and then press the AUTO key. If the cycle has not been completed, press SHIFT and STOP simultaneously, then press AUTO. The LED will turn off and the system will be in manual mode.

Arrow Keys: The arrow keys are used to select data fields and position the cursor in a field.

AXIS: This key has no operation. It is disabled.

CLEAR: The clear key is used to clear drive and feed angle lost errors. When clearing a drive error the CTA10 sends a serial command to reset the class 1 diagnostic error. If the drive is in an error state, the LED will be on. The clear key is only active when the LED is on. An operator should go to the drive status display (F5) to review the error message before clearing a drive error.

ENTER: The enter key is used to save entered data.

ESC: The escape key is used to close pop-up messages and return to the previous screen.

F5: The F5 key is used to jump to the drive status display. When the CTA10 detects a drive error, it will flash the LED on the F5 key.

HELP: When pressed, the page-specific help is displayed (in AUTO/MANUAL mode). Release the key to return to the display screen.

HOME: This key has no operation. It is disabled.

JOG+ / JOG- : When a jog key is pressed, the drive start signal (AH) is used to command motion and the position block mode is set to "Traverse in a positive/negative direction". The feedrate override is set to 100% for a normal jog. Pressing SHIFT-JOG will set the override to 10% so that a slow jog can be used. (This function is available only if Feedrate Override is disabled in System Parameter C-0-0018.) Jog keys are active only when the system is in manual mode.

SHIFT-Down: Decrement current field (micro-adjust). When micro-adjusting integer values, the number will change by 1. When micro-adjusting floating point values, the number will change according to system parameter C-0-0002 Micro-Adjust Value.

SHIFT-Up: Increment current field (micro-adjust). When micro-adjusting integer values, the number will change by 1. When micro-adjusting floating point values, the number will change according to system parameter C-0-0002 Micro-Adjust Value.

SHIFT-ESC (reboot): This key combination is used to reboot the CTA10. It has the same effect as power cycling the CTA10.

START: The cycle start key is only active in automatic mode. If the Press Interface parameter (C-0-0008) is set to press before feed, the START button will cause the CTA10 to look for a low-to-high transition on the Feed Angle Input and then begin cycling. When the feed before press mode is selected, the CTA10 will automatically cycle as soon as the Feed Angle Input is high.

STOP: The cycle stop key is only active in automatic mode while cycling. It will stop the feeder after the completion of the current cycle.

SHIFT-STOP: This key combination is used to stop the feeder immediately, even if the current cycle is not complete.

2 CTA10 Display

Note: These displays are accessible from AUTO or MANUAL modes only.

2.1 Display Overview

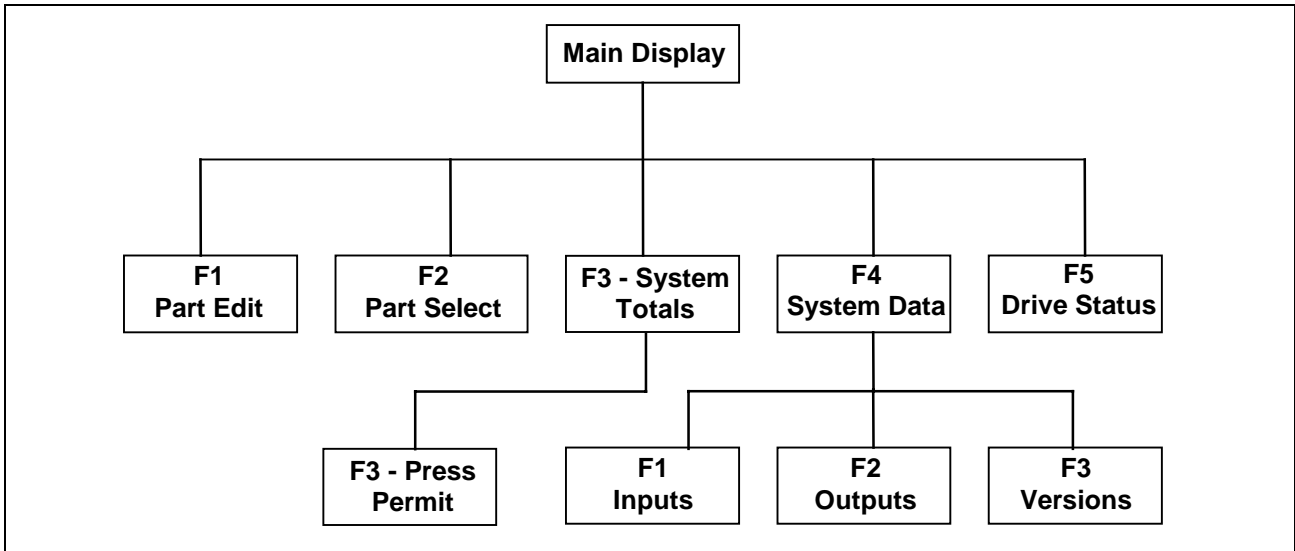


Fig. 2-1: Display Overview

The boxes below indicate screen displays. The text on the left represents the normal screen display. The text on the right will be displayed when the help key is pressed. Press ESC to return to the previous screen.

2.2 Main Display

SYSTEM STATUS ACTIVE PART: 105 01234.567 in 12.34%	F1: PART EDIT F2: PART SELECT F3: SYSTEM TOTALS F4: SYSTEM DATA
---	--

The main page displays the active part number along with its length and rate. The system status is listed on the top line of the display. No editing can be done from this page.

2.3 Part Edit Display (F1)

SYSTEM STATUS EDIT PART: 105 LENGTH: 01234.567 RATE: 12.34%	Select Part To Edit. Part data will be stored immediately.
--	--

The operator can edit the length and rate for any part from the part edit page. Data for the currently executing part will be used on the next position cycle. The maximum velocity, acceleration and jerk associated with each part must be entered in parameter mode. The system status is listed on the top line of the display.

Note: Changes to the length and rate are stored to the flash EPROM on a power cycle or when a new part is selected.

2.4 Part Select Display (F2)

SYSTEM STATUS	Enter QUANTITY = 0
SELECT PART: 105	for a free run.
QUANTITY: 123456	F1: INC. F2: DEC.
COUNT: 123456	F3: CLEAR COUNT

The operator selects the active **part number** from this screen. When a new part is selected, the position block data will be sent immediately to the DKC. The new data will become active on the next cycle. The system status is listed on the top line of the display.

Note: The LED on the F1, F2 and F3 keys will be on to indicate that they have a special function while this screen is active.

The operator can enter the desired **quantity** of parts to run. Entering a quantity of 0 specifies a free run condition. The CTA10 will initiate part cycles until the count is greater than or equal to the quantity specified. At this point, the CTA10 will cycle stop and reset the part count value, or it will flash the Cycle Stop LED and continue cycling with the counter increasing. This option is selected in System Parameter **C-0-0011** - Batch Completion. Refer to **3.5 System Data (F3)** for details.

The operator may alter the target quantity at any time during the run. Pressing the **F1** key will add a part to the count. Pressing **F2** will subtract a part from the count. Pressing **F3** will reset the count to 0. During a free run condition (quantity = 0) **F1** and **F2** are inactive.

2.5 System Totals Display (F3)

SYSTEM STATUS	F1: CLEAR LENGTH
SPM: 0000 USE: 00%	F2: CLEAR PIECES
L:1234567890.123	F3: PERMIT PRESS
PIECES: 123456	

The system totals display provides the user with the total length and the total pieces (cycles) fed. This information is retained through a power cycle. The counters are updated at the end of a cycle. Partial feeds are not counted. To clear the total length accumulator, press the **F1** key. To clear the total piece count accumulator, press the **F2** key.

Note: The LED on the F1 and F2 keys will be on to indicate that they have a special function while this screen is active.

The system status is listed on the top line of the display. The strokes per minute (**SPM:**) and time used (**USE:**) calculations are also listed on this display.

The **SPM** calculation tracks the time between high-to-low transitions of the feed angle. The time used calculation measures the percentage of time the feed consumes before the next high-to-low transition of the Feed Angle Input.

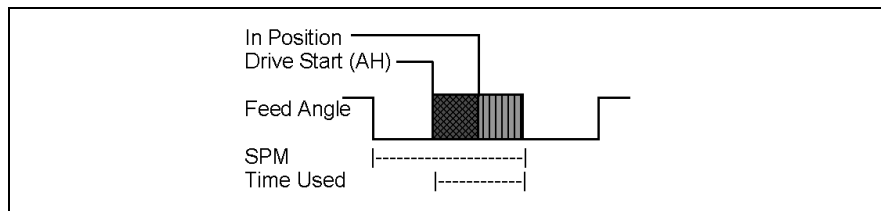


Fig. 2-2: SPM Calculation

Press Permissive Interface (F3)

The Press Permissive Interface is a safety feature that generates a signal that can be used to engage or disengage the press clutch. A high signal permits clutch engagement for press cycle operation (if all other safety logic circuitry on the press is satisfied). A low signal disengages the clutch and press operation halts.



WARNING

The machine builder should tie this signal into the other "Safety Logic Circuitry" for the press system. Do not use this signal to fire the press without regard for other safety conditions (interlocks open, machine E-Stop, etc.).

The Press Permit display includes the **System Status**, the value of the **Press Permit** signal, the Press Interface setting and the mode of operation. The Press Interface setting determines whether the system will **Feed before Press** or **Press before Feed**. Refer to parameter **C-0-0008** in section **3.5 System Data (F3)** for details. The mode of operation can be **Continuous** or **Intermittent**. Use the left and right arrow keys to select an operating mode. The ENTER key must be pressed to accept the change.

Continuous mode specifies continuous press cycling, synchronized with the material feed. **Intermittent** mode specifies that the press will be cycled on time at the end of, or just previous to, each feed cycle.

The timing of the Press Permit signal depends on the press interface setting and the mode of operation. See the timing charts illustrated below for the specific timing of this signal.

Continuous Mode - Feed before Press

SYSTEM STATUS	Press the ESC
Permit Press: 0	key to return
Feed then Press	to the System Totals
Continuous	display.

Permit Press is issued after the first feed is completed. In Continuous Mode, it remains high during the automatic cycling. It goes low if the control sees a fault or error, or if a Cycle Stop is issued.

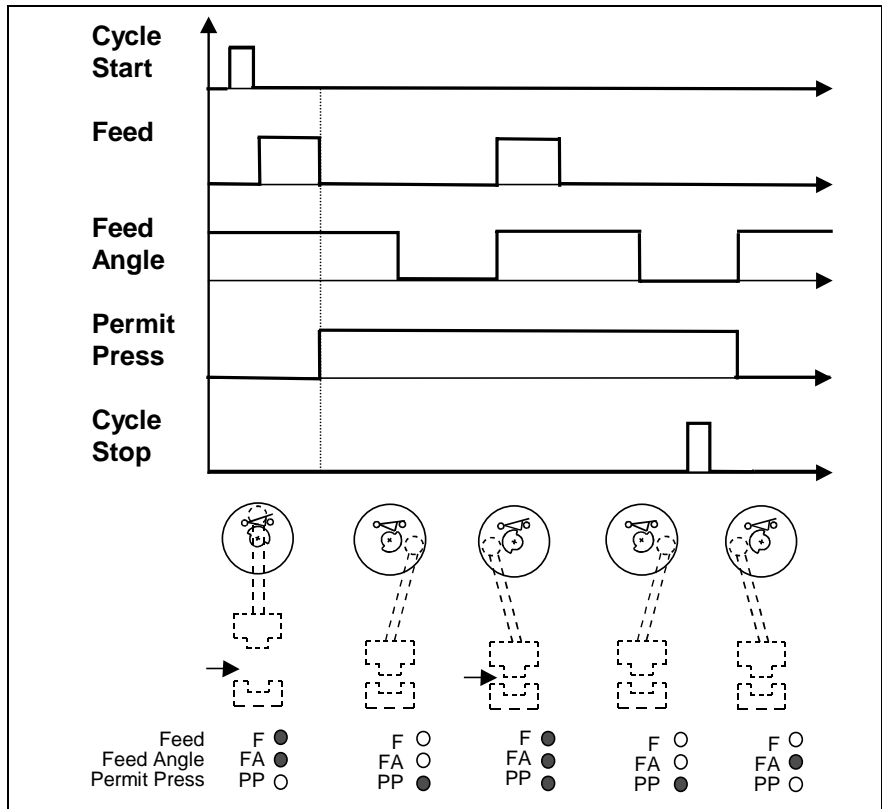


Fig. 2-3: Permit Press timing chart - Continuous/Feed before Press

Intermittent Mode - Feed before Press

SYSTEM STATUS	Press the ESC key to return to the System Totals display.
Permit Press: 0	
Feed then Press	
Intermittent	

In Intermittent Mode, Permit Press is issued after a feed cycle is complete, and dropped when the feed angle becomes high or a cycle stop is issued.

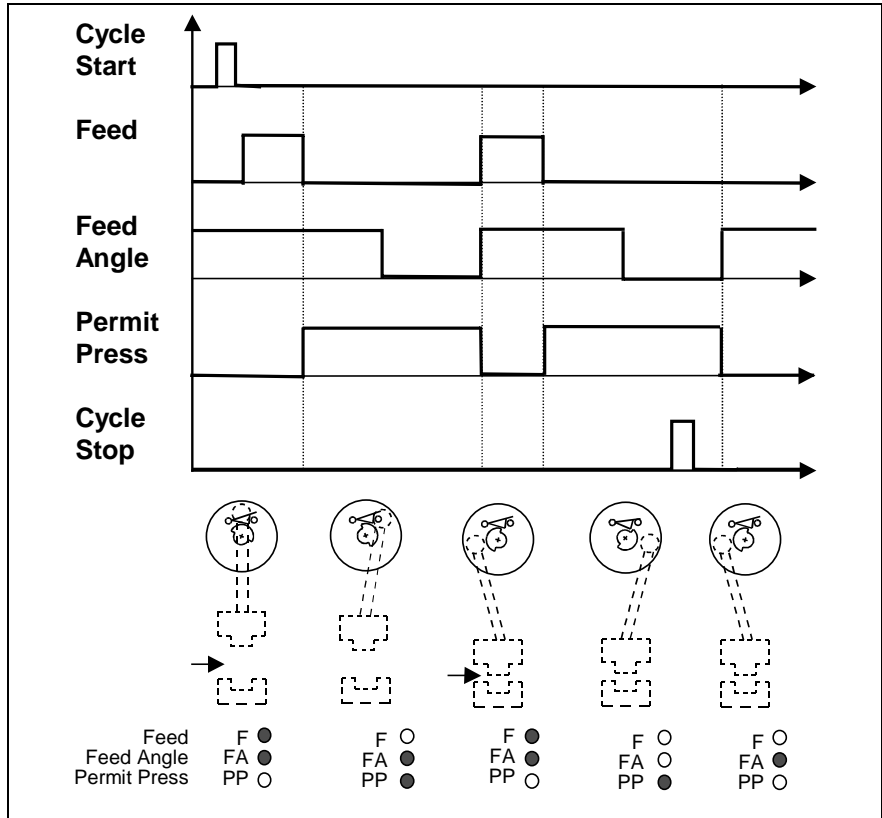


Fig. 2-4: Permit Press timing chart - Intermittent/Feed before Press

Continuous Mode - Press before Feed

SYSTEM STATUS	Press the ESC key to return to the System Totals display.
Permit Press: 0	
Press then Feed	
Continuous	

Permit Press is issued after a Cycle Start. In continuous Mode, it remains high during the automatic cycling. It goes low if the control sees a fault or error, or a Cycle Stop is issued.

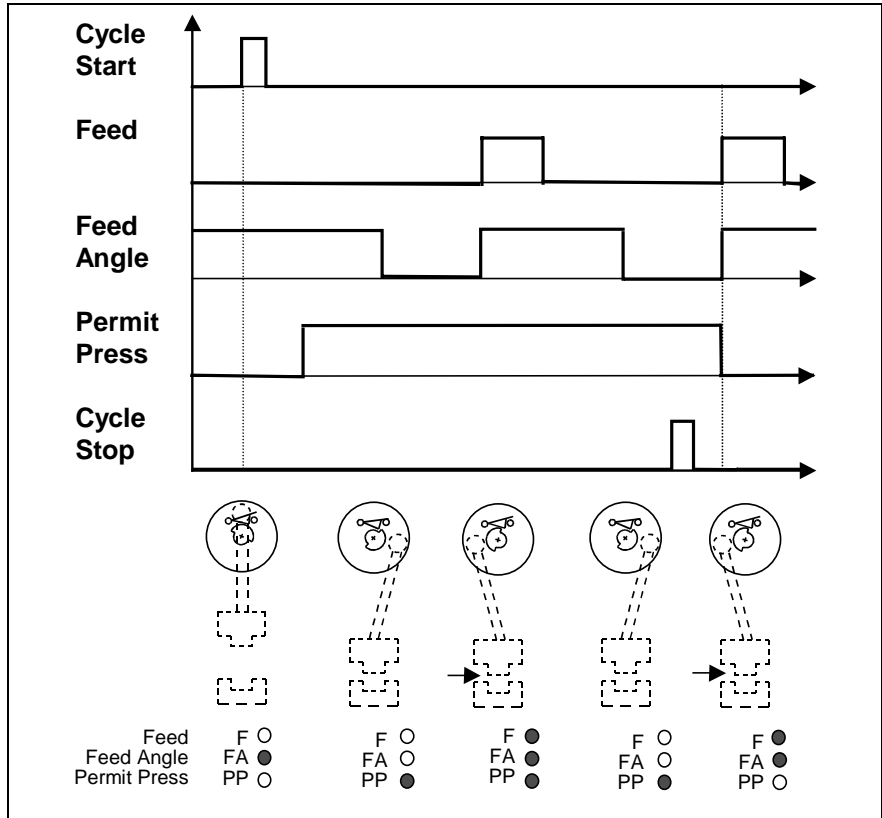


Fig. 2-5: Permit Press timing chart - Continuous/Press before Feed

Intermittent Mode - Press before Feed

SYSTEM STATUS	Press the ESC key to return to the System Totals display.
Permit Press: 0	
Press then Feed	
Intermittent	

In Intermittent Mode, Permit Press is issued after a cycle start, and dropped when the feed angle becomes high. After a feed cycle is complete, the Permit Press is issued again until the feed angle becomes high.

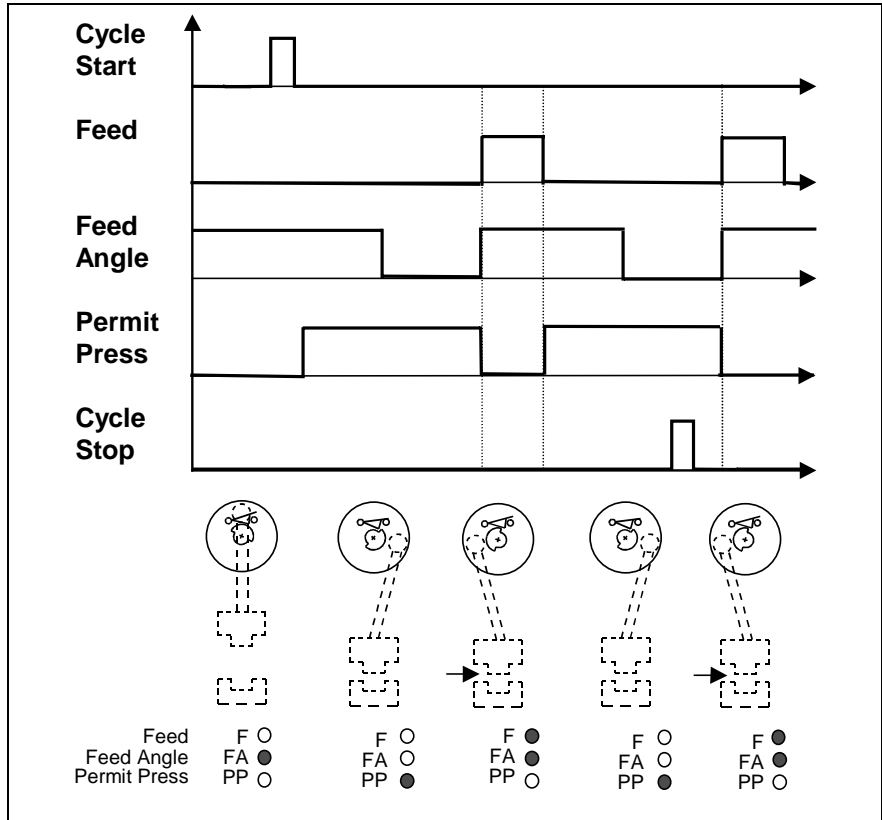


Fig. 2-6: Permit Press timing chart - Intermittent/Press before Feed

2.6 System Data Display (F4)

SYSTEM STATUS	Press the ESC
F1: Inputs	key to return
F2: Outputs	to the previous
F3: Versions	display.

The System Data Display contains a sub menu that is used to select system data displays. Press the corresponding function key to view the desired display. The system status is listed on the top line of the display.

Refer to chapter 4, *CTA10 Input/Output System* for more information.

System Inputs (F1)

Feed Angle: 0	Press the ESC
Param Mode: 0	key to return
In Motion: 0	to the previous
In Position: 0	display.

The system input display shows the current state for each of the four input signals. A one means the signal is high, and a zero means it is low. The system status is not listed on the top line of this display.

System Outputs (F2)

Drive Enable: 0	Press the ESC
Drive Start: 0	key to return
Permit Press: 0	to the previous
Manual Mode: 0	display.

The system output display shows the current state for each of the four output signals. A one means the signal is high, and a zero means it is low. The system status is not listed on the top line of this display.

Versions (F3)

SYSTEM STATUS	Press the ESC
CTA10*-DK1-03VRS	key to return
ESM2.1-SGP-01V13	to the previous
MKD025B-144-KG0	display.

The versions display shows the type codes for the CTA10, DKC and the motor. The system status is listed on the top line of the display.

2.7 Drive Status (F5)

SYSTEM STATUS	This screen displays the current system & drive status.
DRIVE STATUS	
MESSAGE	

The Drive Status display lists the system and drive status. The current drive diagnostic text is displayed on the lower three lines. This display can be viewed at any time by pressing the **F5** key.

3 CTA10 Parameter Mode Display

3.1 Display Overview

The boxes below indicate screen displays. The text on the left represents the normal screen display. The text on the right will be displayed when the help key is pressed. Press ESC to return to the previous screen.

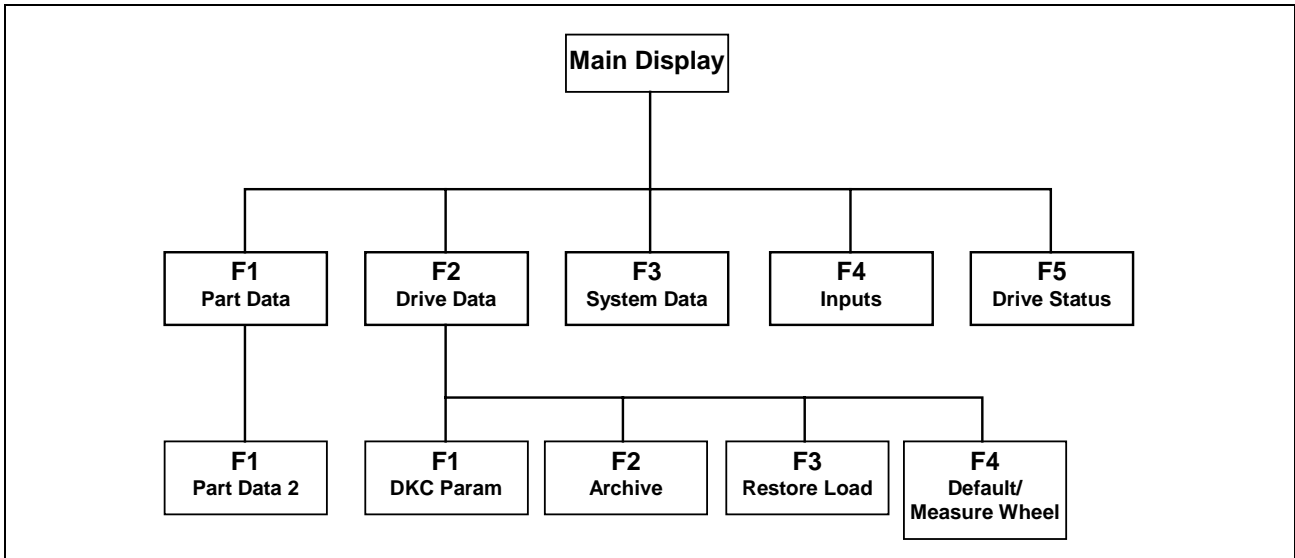


Fig. 3-1: Parameter Mode Overview

3.2 Main Parameter Mode Display (ESC)

F1: Part Data
F2: Drive Data
F3: System Data
F4: Inputs

Upon entering parameter mode, the above menu is displayed. Press the corresponding function key to access the desired data. Pressing the **F5** key will display the current drive status. The DKC will continue to be polled for drive errors while in parameter mode.

3.3 Part Data Display (F1)

PART NUMBER: 105 VEL: 12345.678 ACCEL:123456.78 JERK: 1234567.8	Press the F1 key to edit the length and rate data.
--	--

Press the **F1** key in the Part Data display to edit the parts length and rate. These values can also be edited from the Part Data Display (F1) in normal operation mode. Refer to 2.3 *Part Edit Display (F1)* for details.

PART NUMBER: 105 LENGTH: 01234.567 RATE: 12.30 %	Press the ESC key to return to the previous display.
---	--

The part data display is used to enter separate velocity, acceleration, jerk, length and rate for each part. To select a part to edit, simply enter the part number. Use the up and down arrow keys to select the parameter data to edit. The parameters will be verified and saved to FLASH EPROM when exiting parameter mode or when selecting a new part to edit.

Note: When editing a new part, the velocity and acceleration will be defaulted to 100% of the current maximum settings in the DKC.

3.4 Drive Data Display (F2)

F1: ECODErive Prm.	Press the ESC
F2: Archive	key to return
F3: Restore	to the previous
F4: Load Default	display.

The drive data display is used to edit, archive or restore DKC parameters. The DKC can also be commanded to load its default list of parameter values.

DKC Parameter Display (F1)

PARAM. # UNITS	PARAM. # UNITS
Description	MAX VALUE
Value	MIN VALUE
	Maximum/Minimum

The DKC Parameter display is used to edit a limited set of DKC parameters. The parameter number, units, text description and data will be displayed. Press and hold the HELP key to view the minimum and maximum values for the parameter.

Note: A complete set of DKC parameters can be edited/viewed by pressing the "blank" key while on the Drive Data Display. Refer to 3.4 Drive Data Display (F2). The CTA10 will ask for a password before it uploads the list from the DKC. The password is currently "645-3600" (telephone number for Bosch Rexroth USA).

Archive Display (F2)

CONFIRM Archive Parameters YES NO
--

The Archive display allows the user to archive the set of DKC operational parameters from this listing. Parameters are saved in the flash EPROM on the CTA10. The operator will be prompted before this operation is done. Use the arrow keys to select "YES" or "NO" and then press ENTER.

Restore Display (F3)

CONFIRM	
Restore	
Parameters	
YES	NO

The Restore display allows the user to restore the set of DKC operational parameters from this listing. Parameters are saved in the flash EPROM on the CTA10. The operator will be prompted before this operation is done. Use the arrow keys to select "Yes" or "No" and then press ENTER.

Load Default (F4)

If Measuring Wheel Inactive

CONFIRM	
Load Default	
Parameters	
YES	NO

The Load Default display is used to set the default DKC parameters. This is done in parameter mode from the drive data screen. The CTA10 will issue the DKC command P-0-4094, followed by the command S-0-0262. The CTA10 will then send the set of forced configuration parameters. Next, the DKC will be brought to phase 4 and back to phase 2 to force recalculation of the parameter set. If there are any invalid parameters found at this point, they will be set to the minimum or maximum value for that parameter. The operator will be prompted before this operation is done. Use the arrow keys to select "Yes" or "No" and then press ENTER.

Note: Following this command the CTA10 will default to metric units to match what the DKC has loaded. Please also note that the communication parameters will be reset to 9600 baud with an RS485 answer delay of 0.

Measure Wheel (F4)

If Measuring Wheel Active only for ECODRIVE03

When the measuring wheel (Parameter C-0-0019) is set to "Active," pressing F4 Measure Wheel from the Drive Data Display jumps to the screens for setting the parameters relevant to the measuring wheel. The down-arrow allows scrolling through the parameter screens, in the following order:

Parameter	Description
S-0115	Position feedback type / direction (rotary or linear)
S-0117	Feedback 2 resolution (in mm or rotations)
S-0123	Measuring wheel feed constant
S-0391	Monitoring window feedback (0)
P-0075	Feedback 2 type
P-0221	Measuring wheel filter time constant
P-0121	Velocity mix factor feedback (0%)

Table 3-1: Measuring Wheel Parameters

For example:

S-0115 Position feedback 2 type 000000000001001
--

3.5 System Data (F3)

Parameter	Description
C-0-0000	Language: Czechoslovakian, English, German, French, Italian, Portuguese, Spanish and Swedish
C-0-0001	Units (inches, mm)
C-0-0002	Micro-Adjust Value: Amount used to adjust floating point numbers
C-0-0003	Max. Length: Greatest length an operator can enter.
C-0-0004	Min. Length: Smallest length an operator can enter.
C-0-0005	Max. Change In Length: The largest change in length an operator can enter while cycling in automatic mode.
Entering zero for one of the length parameters (C-0-0002 - C-0-0005) will disable that feature. If the operator enters a value outside the configured parameter ranges, the CTA10 will modify the data. No error message will be generated. The maximum and minimum DKC length limits are also still in force.	
C-0-0006	Position Polarity: Selects if the motor should turn in a positive or negative direction.
C-0-0007	Slip Distance: Selects whether the DKC will Operate with lag or without.
C-0-0008	Press Interface: Selects press before feed or feed before press.
C-0-0009	Press Mode (continuous/intermittent)
C-0-0010	Press Time Out (minutes). If the CTA10 does not see a transition on the feed angle signal within the specified interval while cycling in automatic mode, a fault will be generated.
C-0-0011	Batch Completion: Select to cycle stop on completion, or flash the cycle stop LED and continue cycling.
C-0-0012	Flash: Static usage display
C-0-0013	Serial Baud Rate
C-0-0014	RS485 Delay Time
C-0-0015	Highest Station Address
C-0-0016	Version: CTA10*DK1-03VRS (firmware code) Date (firmware date)
C-0-0017	Feed Angle Filter (ms)
C-0-0018	Feed Rate Override (enable/disable)
C-0-0019	Measuring Wheel (enable/disable)

Table 3-2: CTA10 System Parameters

3.6 System Inputs Display (F4)

Feed Angle:	0	Press the ESC key to return to the previous display.
Param Mode:	0	
In Motion:	0	
In Position:	0	

The system input display shows the current state for each of the four input signals. A "1" means the signal is high, and a "0" means it is low. This screen is useful when configuring the monitoring windows, or testing I/O wiring.

3.7 Drive Status Display (F5)

SYSTEM STATUS DRIVE STATUS MESSAGE	This screen displays the current system & drive status.
---	---

The Drive Status display lists the system and drive status. The current drive diagnostic text is displayed on the lower three lines. This display can be viewed at any time by pressing the F5 key.

4 CTA10 Input/Output System

The CTA10 contains 4 digital inputs and outputs. The outputs require an external 24-volt power supply. The input voltage should be 24 volts. All I/O connections are located on connector X4. The following table indicates the pin assignments.

4.1 CTA10 Inputs

Connector - Pin	Description
X4 - 1	Feed Angle
X4 - 2	Parameter Mode
X4 - 3	In Motion
X4 - 4	In Position

Table 4-1: CTA10 Inputs

Feed Angle Input: This signal comes from the press. When the press is up the Feed Angle Input is high. When the press is down the Feed Angle Input is low. The CTA10 will not allow jogging when this input is low. If the Feed Angle Input goes low during a feed cycle, the motion will be halted and the DKC will cycle stop. The error diagnostic "Feed Angle Lost" will be displayed.

Parameter Mode Input: The Parameter Mode Input should be connected to a keyed input. When this input is high, the CTA10 will enter parameter mode. No motion is allowed while in parameter mode. Any motion in progress will be halted. The DKC will be forced into phase 2.

In Motion Input: The In Motion Input comes from the DKC. This signal is high if the axis is rotating at a velocity greater than the velocity tolerance window.

In Position Input: The In Position Input comes from the DKC. This signal is high when the DKC is within the position tolerance window.

4.2 CTA10 Outputs

Connector - Pin	Description
X4 - 5	Drive Enable (RF)
X4 - 6	Drive Start/Stop (AH) – DKC 1.1 Block Start – DKC 1.3
X4 - 7	Permit Press
X4 - 8	Manual Mode Indicator

Table 4-2: CTA10 Outputs

Drive Enable Output: The Drive Enable Output should be connected to the RF Input on the DKC. This signal will be low if the CTA10 is in parameter mode, or during a fatal error condition.

Drive Start/Stop Output: The Drive Start/Stop Output should be connected to the AH Input on the DKC. The output is set high while cycling in automatic mode or while jogging in manual mode.

Permit Press Output: This signal is configurable by a parameter to operate in Continuous or Intermittent modes (C-0-0009). It also takes into account the Press Interface selection of Press then Feed or Feed then Press (C-0-0008). This signal will only be high while cycling in auto mode. Refer to *Press Permissive Interface (F3)* on page 2-3 for details.

Manual Mode Indicator Output: This output is high in manual mode and it can be used to enable the external jogging function or it can be wired to an indicator.

4.3 Emergency Stop

A separate Emergency Stop (E-Stop) palm button will be required to remove incoming 3-phase power from the DKC. **There is no E-Stop available from the CTA10 operator interface.** To halt the DKC more quickly, the E-Stop logic may remove the drive enable signal. The CTA10 polls the drive states and will recover if this signal is removed.

5 CTA10 Modes

5.1 Overview

The CTA10 has four basic modes of operation. Motion is only possible in manual mode and automatic mode.

5.2 Parameter Mode

The CTA10 enters parameter mode when there is a high signal detected on the Parameter Mode Input. Refer to 4.1 CTA10 Inputs for details. The system will stay in this mode while the Parameter Mode Input is high. Before exiting this mode, the integrity of the parameter system is verified. While in this mode all CTA10 outputs will be low. Exiting this mode will switch the CTA10 into initialization mode.

5.3 Initialization Mode

The CTA10 enters this mode directly from parameter mode or if there is a drive or feed angle error. All CTA10 outputs are brought low when entering this mode. The system will remain in this mode until the DKC is ready for operation. After the system determines that the DKC is ready, the CTA10 will switch into manual mode. The drive enable signal is brought up before exiting this mode.

5.4 Manual Mode

In manual mode, the Drive Start Signal will be low. Jogging will be permitted only when the Feed Angle Input is high. The Feed Angle Input is scanned while in manual mode. If this signal goes low while the DKC is in motion (i.e. jogging) the system will set the feed angle lost error condition and drop into initialization mode. This means that the CTA10 will monitor loss of feed angle even if an external device is using the jog inputs on the DKC.

5.5 Automatic Mode

Automatic mode is entered by pressing the AUTO key while in manual mode. The AUTO key LED will turn on indicating that it is in automatic mode. The system will return to manual mode by pressing the AUTO key again as long as you are not cycling. While in automatic mode, pressing the START key will continuously cycle the DKC using position block data for the active part.

When operating in "Press Before Feed" mode the system will set the Drive Start/Stop (AH) Output high when it sees a low to high transition on the Feed Angle Input. In "Feed Before Press" mode, the cycle will begin as soon as the Feed Angle Input is high. The system will reset the Drive Start/Stop Output when it determines that the DKC has reached its target position (In Position Input is high). If the system sees the Feed Angle Input go low before the DKC is in position, the feed angle lost error condition will be set and the CTA10 will drop into initialization mode.

6 CTA10 Diagnostics

6.1 Overview

The top line of most of the displays is reserved for the system diagnostic text. This text messages are used to describes the system state and error conditions. Communication errors are not part of the diagnostic system. They are enunciated with a pop-up window.

6.2 System Status

During normal operation, the top line of the CTA10 display will show a system status message. The following descriptions list each of the status messages.

Parameter Mode Status Text

Text	Description
PARAMETER MODE	The CTA10 is in parameter mode.

Table 6-1: Parameter Mode Status Text

Initialization Status Text

Text	Description
SETTING PHASE 2	The DKC is being set to phase 2.
INITIALIZING	The CTA10 is in initialization mode.
SETTING PHASE 3	The DKC is being set to phase 3.
SETTING PHASE 4	The DKC is being set to phase 4.

Table 6-2: Initialization Status Text

Manual Mode Status Text

Text	Description
MANUAL MODE	The CTA10 is in manual mode.
JOG FORWARD	The CTA10 is jogging the DKC forward.
JOG REVERSE	The CTA10 is jogging the DKC in reverse.
AXIS IN MOTION	The In Motion Output is high. This may also indicate that someone is jogging with an optional Jog Pendant.

Table 6-3: Manual Mode Status Text

Automatic Mode Status Text

Text	Description
AUTOMATIC MODE	The CTA10 is in Automatic Mode waiting for cycle start.
AWAIT PRESS	Waiting for the Feed Angle Input to go low while cycling in Automatic Mode.
AWAIT FEED ANGLE	Waiting for the Feed Angle Input to go high while cycling in Automatic Mode.
AWAIT IN MOTION	Waiting for the In Motion Input to go high while cycling in Automatic Mode.
FEEDING	Waiting for the In Position Input to go high while cycling in Automatic Mode.
BATCH COMPLETE	The CTA10 has reached the target count and cycle stop was selected for the Batch Completion Parameter (C-0-0009).
COMPLETING FEED	A Cycle Stop has been selected in Automatic Mode but is delayed until the current part completes its cycle feed.
CYCLE STOP	A Cycle Stop has been selected after running in Automatic Mode.

Table 6-4: Automatic Mode Status Text

Drive Warnings

Warning	Description
DRIVE DISABLED	The Drive Enable Output from the CTA10 is not reaching the DKC Drive Enable Input. Check the wiring and the connections.
DRIVE NOT READY	The DKC has not reached the AB state. Press F5 to view drive status. Refer to the DKC manual for corrective action.

Table 6-5: Drive Warnings

6.3 System Faults

The CTA10 will continuously poll the DKC for drive faults. When an error is detected the LED on the CLEAR key will light and the LED on the **F5** key will flash. The operator should look at the drive status display for the error text.

Hard Faults

A Hard Fault is a Drive fault that forces the CTA10 into initialization mode. All outputs will be dropped (including the RF signal) and the DKC will cycle stop. (The RF signal is not dropped until the DKC *In Motion Output* is low.) The error is cleared when the operator presses the CLEAR key.

The following is a brief description of the fault messages.

Fault	Description
DRIVE ERROR	A DKC fault has been detected. Press F5 to view drive error. Refer to the DKC manual for corrective action.
FEED ANGLE LOST	The Feed Angle Input went low while the In Motion Input was high, or while jogging in Manual Mode. Check the input connection from the Feed Angle Switch. Ensure that the mechanical functions and timing are sequenced properly. Decrease the feed length or increase the feed rate.

Table 6-6: Hard Faults

Soft Faults

A Soft Fault will cause the DKC to cycle stop, however it will not drop the RF signal and it will not force the CTA10 into initialization mode. The error is cleared when the operator presses the CLEAR key.

The following is a brief description of the fault messages.

Fault	Description
PRESS TIME OUT	If the CTA10 does not see a transition on the feed angle signal within the specified interval while cycling in automatic mode, a fault is generated.
MOTION TIME OUT	A fault is generated if the CTA10 does not receive an "In Motion" input signal from the DKC within one second after a Cycle Start.

Table 6-7: Soft Faults

6.4 Firmware Errors (Troubleshooting)

The following table describes the firmware error codes that are displayed on the CTA10 screen.

Error Code	Description	Possible Cause	Remedy
2	Bus error.	The CPU has detected a bus error.	Contact Bosch Rexroth Service.
3	Address error.	The CPU has detected an address error.	Contact Bosch Rexroth Service.
4	Illegal instruction.	The CPU was instructed to execute an unknown instruction. Most likely a problem with the EPROM.	Contact Bosch Rexroth Service.
5	Divide by zero.	The CPU has caught a divide by zero error.	Contact Bosch Rexroth Service.
8	Privilege violation.	The CPU was instructed to execute a supervisory level instruction while in user mode.	Contact Bosch Rexroth Service.
24	Spurious interrupt.	The CPU has received an interrupt from an unknown source.	Replace the hardware.
300	Dynamic memory allocation failed.	Software error indicating heap is corrupt.	Reboot hardware. If problem persists, contact Bosch Rexroth Service.
301	Hardware failure (keyboard).	Self-diagnostic test found a stuck key during initialization.	Check the connector cable between the keyboard and hardware. If the problem persists, replace the hardware.
302	Incorrect hardware revision (keyboard).	During initialization, it was determined that the revision level of the keyboard was wrong. Could indicate a hardware error or a change in hardware.	Contact Bosch Rexroth Service
303	Incorrect hardware revision (main board).	During initialization, it was determined that the revision level of the main board was wrong. Could indicate a hardware error or a change in hardware.	Contact Bosch Rexroth Service
304	Power fail detected.	Can be seen if the CPU detects an undervoltage condition.	Check the 24-volt power supply.
305	Error initializing serial port.	The self-test of the serial port failed.	Reboot. If the problem persists, replace the hardware.
306	Initialization of the operating system failed.	If this error persists, it could indicate a problem with the EPROM or RAM.	Contact Bosch Rexroth Service.
307	Initialization of the LCD failed.	If the problem persists, it indicates a hardware error.	Contact Bosch Rexroth Service.
308	Software failure.	Software bug.	Contact Bosch Rexroth Service.
309	Stack overflow.	Software error indicating that the task's allocated stack space has been exceeded.	Contact Bosch Rexroth Service.
310	Invalid FLASH EPROM type.	During initialization, an unsupported FLASH EPROM type was detected. Could indicate a hardware or manufacturing error.	Contact Bosch Rexroth Service.
311	FLASH EPROM failed.	The maximum write cycle limit to the FLASH EPROM has been exceeded.	Replace the hardware.

Table 6-8: Firmware Errors

7.2 CTA10 - DKC01.3 using RS485 Interconnect

Note: Upon each startup, the CTA10 maps the I/O on the DKC1.3, as shown in 7.2 CTA10 - DKC01.3 using RS485 Interconnect. Any unused I/O cannot be mapped.

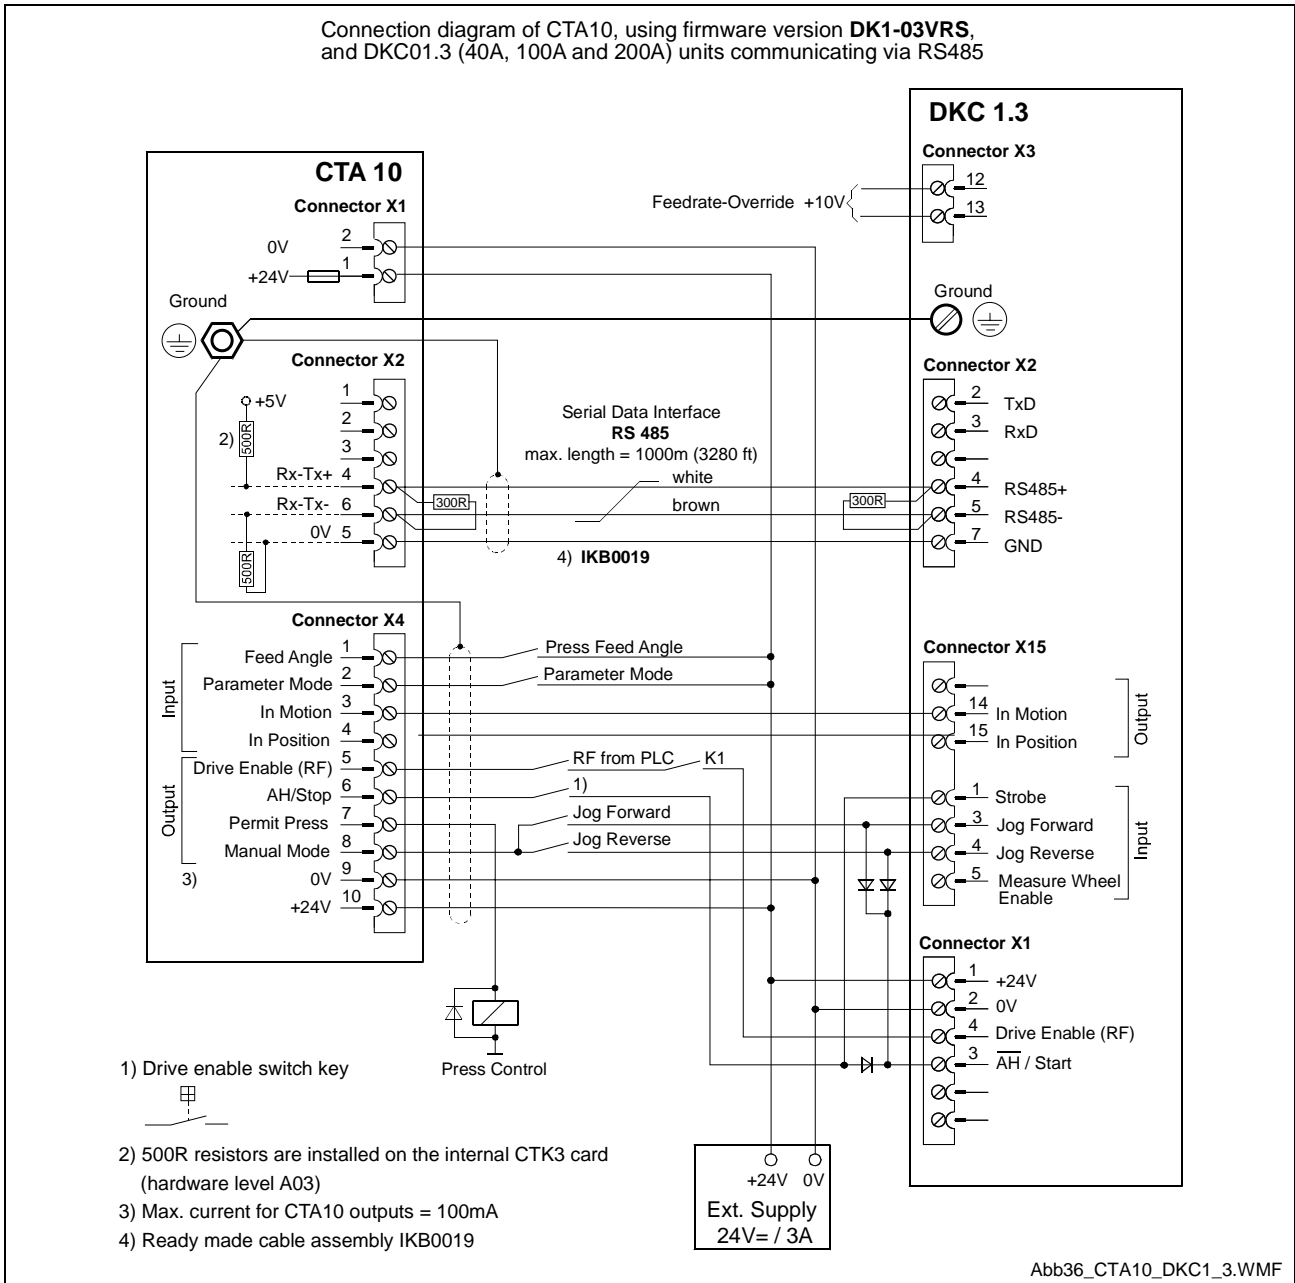


Fig. 7-2: CTA10 - DKC01.3 using RS485 Interconnect

7.3 CTA10 - DKC01.3 using RS232 Interconnect

Note: Upon each startup, the CTA10 maps the I/O on the DKC1.3, as shown in 7.3 CTA10 - DKC01.3 using RS232 Interconnect. Any unused I/O cannot be mapped.

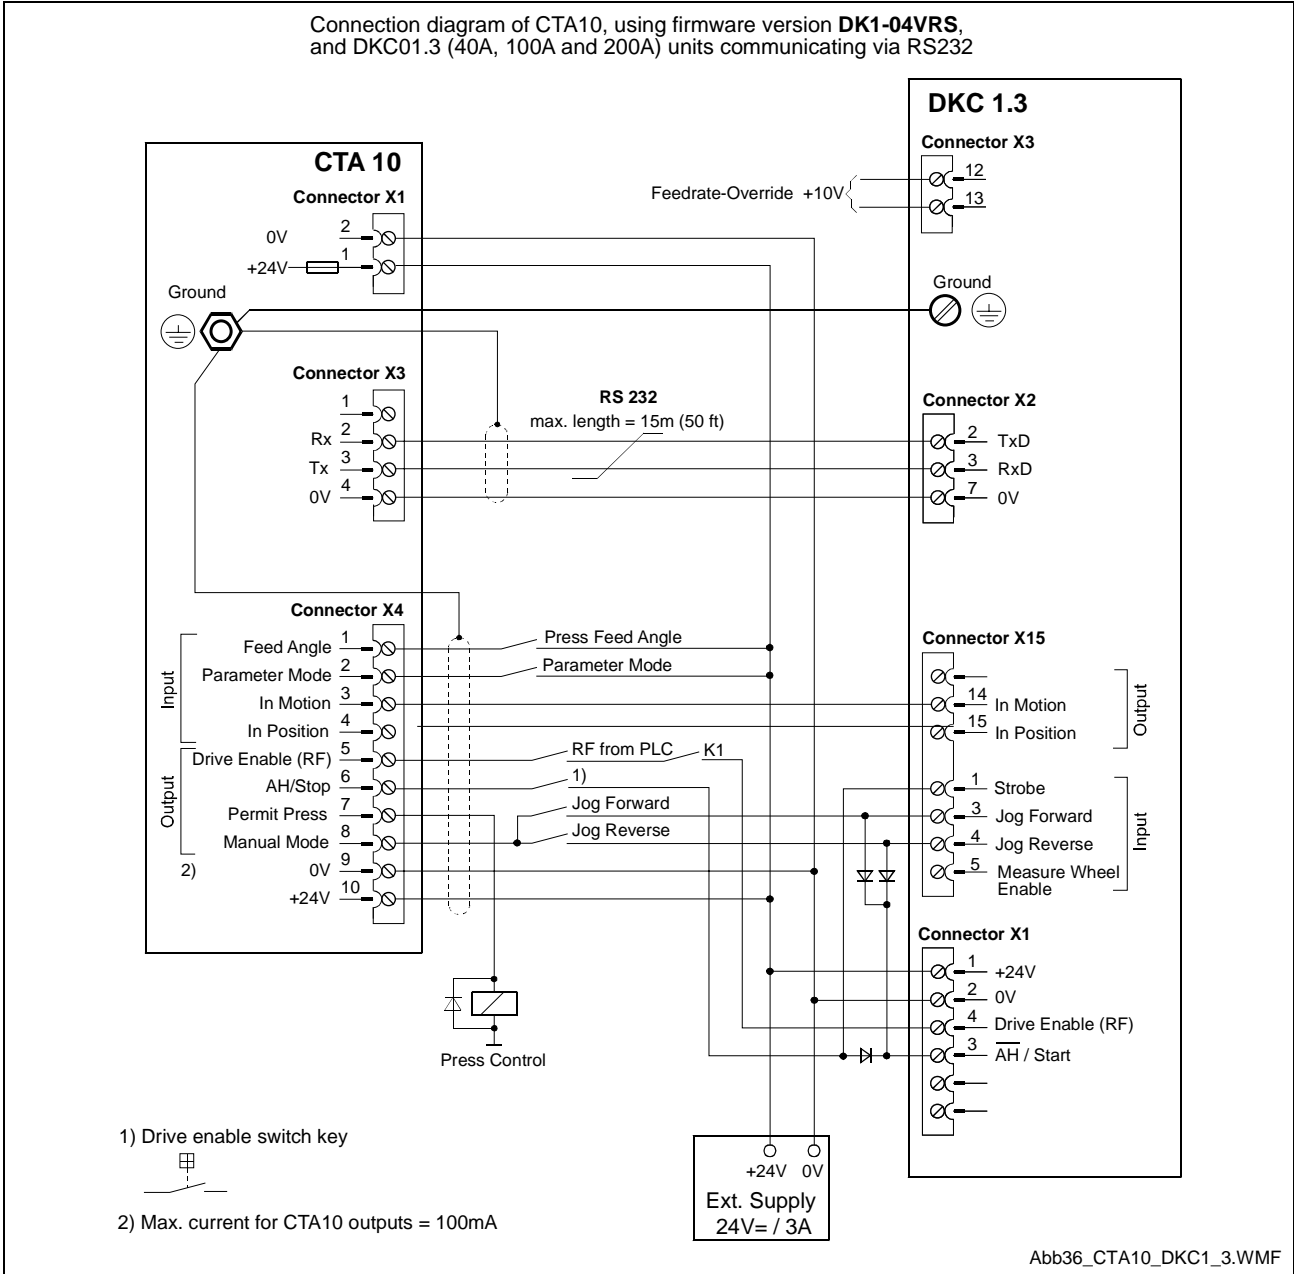


Fig. 7-3: CTA10 - DKC01.3 using RS232 Interconnect

7.4 CTA10 - DKC01.3-016A Interconnect

Note: Upon each startup, the CTA10 maps the I/O on the DKC1.3-016A, as shown in 7.4 CTA10 - DKC01.3-016A Interconnect. Any unused I/O cannot be mapped.

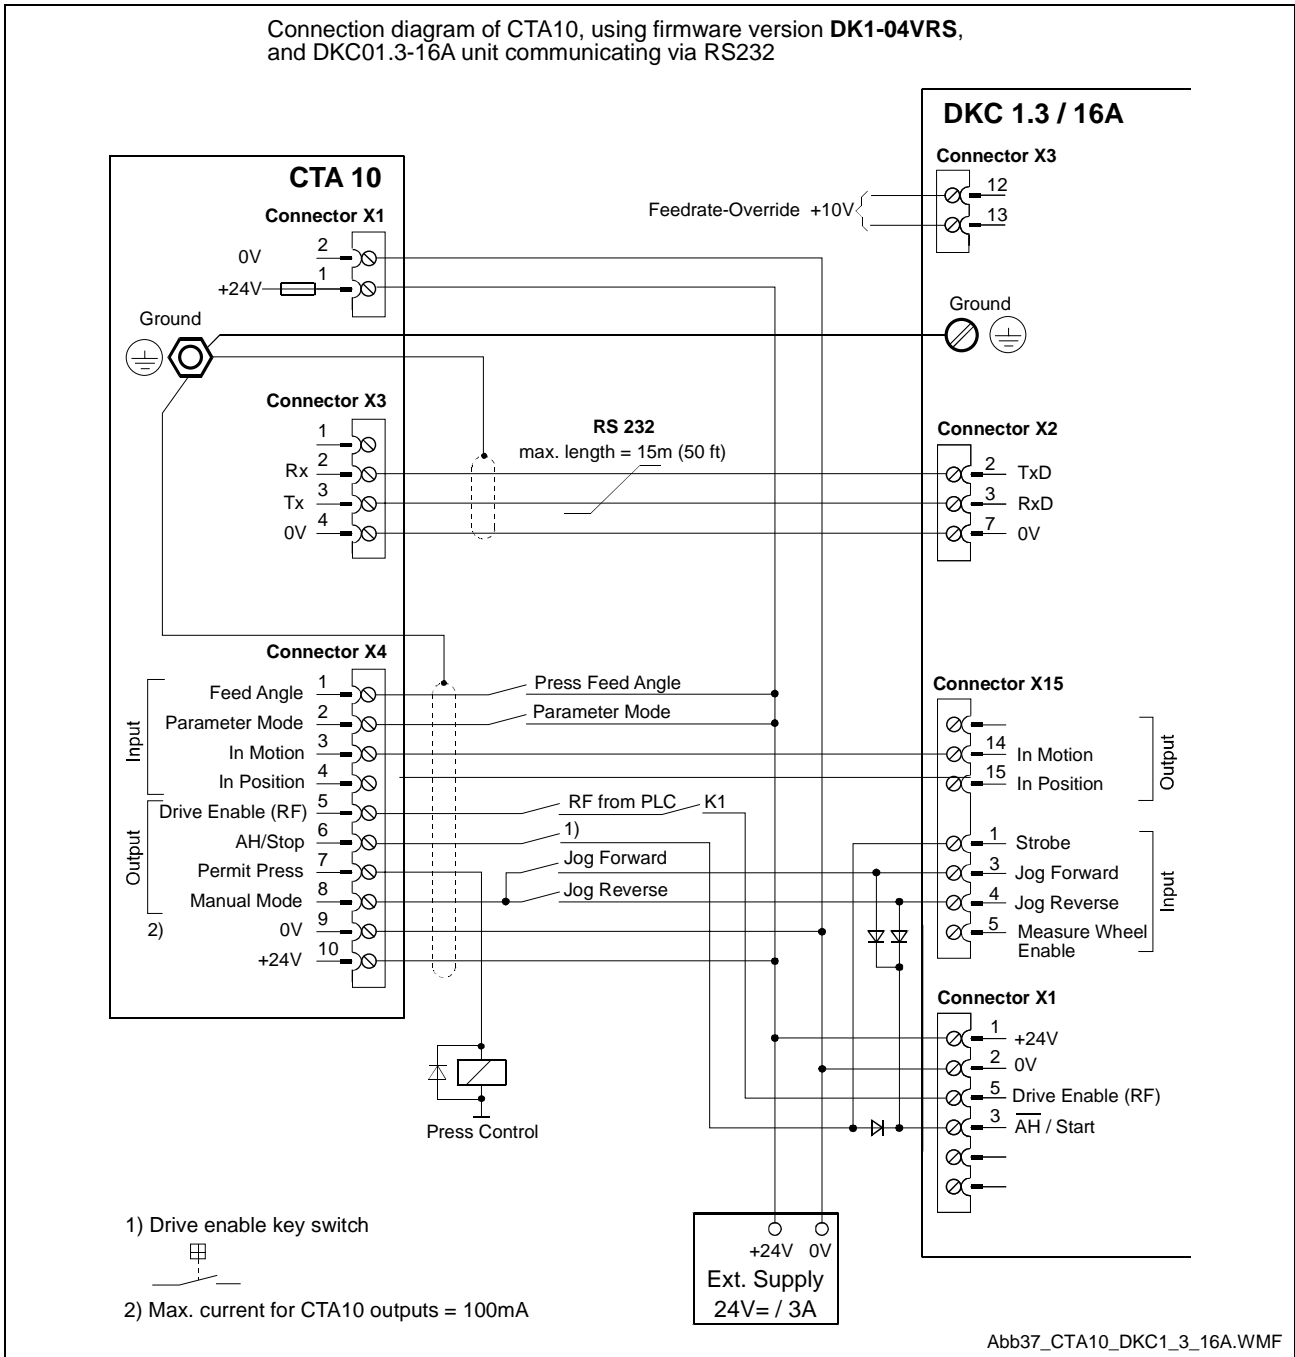


Fig. 7-4: CTA10 - DKC1.3-016A Interconnect

7.5 CTA10 - Layout and Dimensions

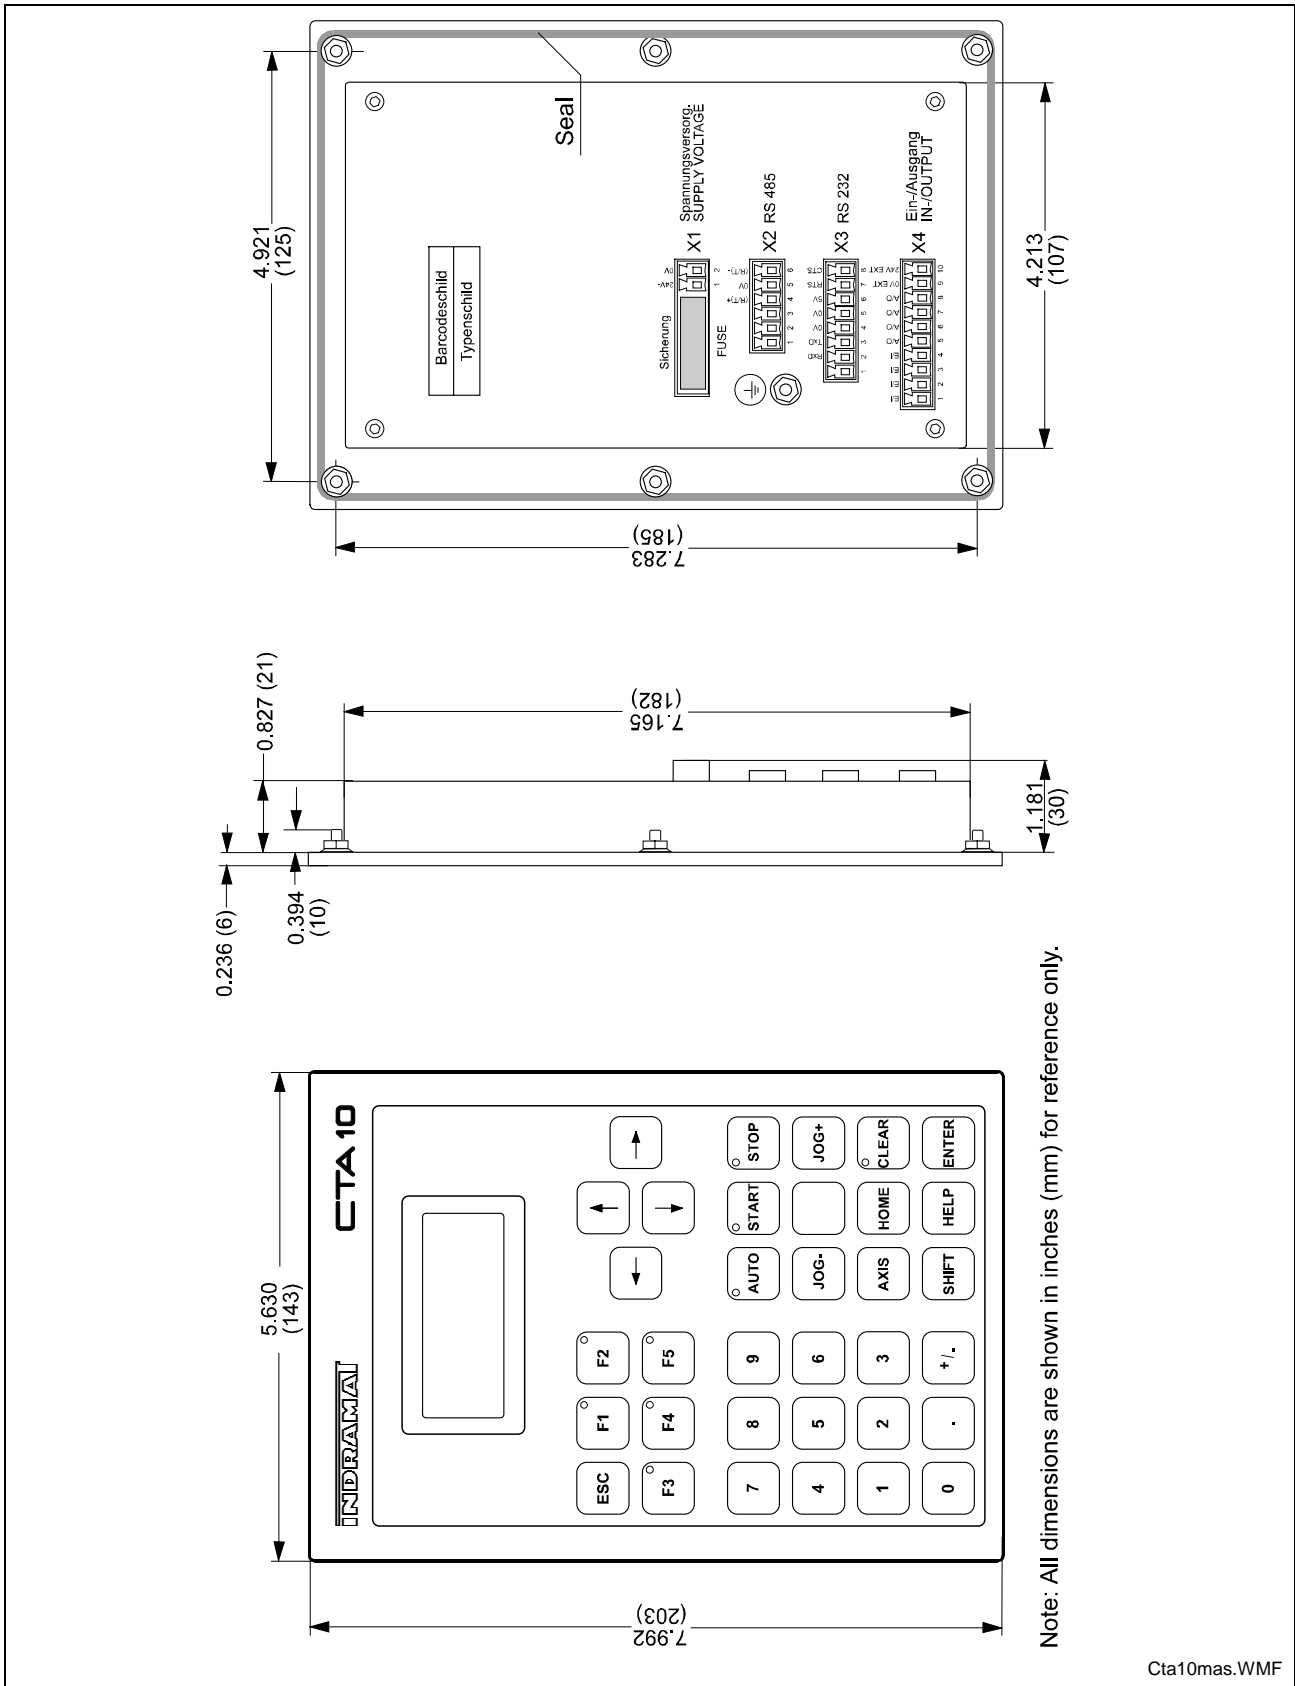


Fig. 7-5: CTA10 - Layout and Dimensions

8 Index

A		Press before Feed 2-7
Archive Display.....	3-2	
Automatic Mode.....	5-1	
B		
Batch Completion	3-4	
C		
C-0-0017.....	3-4	
C-0-0018.....	3-4	
C-0-0019.....	3-4	
C-0016.....	3-4	
Continuous Mode		
Feed before Press.....	2-4	
Press before Feed.....	2-6	
CTA10 - DKC Interconnect.....	7-1	
CTA10/DKC Interface.....	1-1	
D		
Diagnostics.....	6-1	
Display.....	2-1	
Display Overview.....	2-1, 3-1	
DKC Parameter Display	3-2	
Drawings.....	7-1	
Drive Data Display.....	3-2	
Drive Status.....	2-8	
Drive Status Display	3-5	
E		
Emergency Stop.....	4-2	
F		
Feed Angle Filter	3-4	
Feed Rate Override	3-4	
Firmware Code.....	3-4	
flash EPROM.....	2-1	
G		
General Description.....	1-1	
H		
HARD FAULTS.....	6-3	
I		
Initialization Mode.....	5-1	
Input/Output System.....	4-1	
Inputs.....	4-1	
Intermittent Mode		
Feed before Press.....	2-5	
L		
Language.....	3-4	
Load Default	3-3	
M		
Main Display (Esc).....	2-1	
Manual Mode	5-1	
Max. Change In Length.....	3-4	
Max. Length.....	3-4	
Measuring Wheel.....	3-4	
Micro-Adjust Value.....	3-4	
Min. Length.....	3-4	
O		
Operating Modes	5-1	
P		
Parameter Mode	5-1	
Parameter Mode Display	3-1	
Part Data Display.....	3-1	
Part Edit Display (F1).....	2-1	
Part Select Display (F2).....	2-2	
Position Polarity.....	3-4	
Press Interface.....	3-4	
Press Mode.....	3-4	
Press Permissive Interface.....	2-3	
Press Time Out.....	3-4	
R		
Restore Display	3-3	
S		
Slip Distance.....	3-4	
SOFT FAULTS.....	6-3	
System Data Display	2-8	
System Faults.....	6-3	
System Inputs.....	2-8	
System Inputs Display	3-5	
System Outputs	2-8	
System Status.....	6-1	
System Totals Display (F3).....	2-2	
U		
Units.....	3-4	
V		
Versions.....	2-8	

9 Service & Support

9.1 Helpdesk

Unser Kundendienst-Helpdesk im Hauptwerk Lohr am Main steht Ihnen mit Rat und Tat zur Seite. Sie erreichen uns

- telefonisch: **+49 (0) 9352 40 50 60**
über Service Call Entry Center Mo-Fr 07:00-18:00
- per Fax: **+49 (0) 9352 40 49 41**
- per e-Mail: **service@boschrexroth.de**

Our service helpdesk at our headquarters in Lohr am Main, Germany can assist you in all kinds of inquiries. Contact us

- by phone: **+49 (0) 9352 40 50 60**
via Service Call Entry Center Mo-Fr 7:00 am - 6:00 pm
- by fax: **+49 (0) 9352 40 49 41**
- by e-mail: **service@boschrexroth.de**

9.2 Service-Hotline

Außerhalb der Helpdesk-Zeiten ist der Service direkt ansprechbar unter

oder **+49 (0) 171 333 88 26**
+49 (0) 172 660 04 06

After helpdesk hours, contact our service department directly at

or **+49 (0) 171 333 88 26**
+49 (0) 172 660 04 06

9.3 Internet

Ergänzende Hinweise zu Service, Reparatur und Training sowie die **aktuellen** Adressen unserer Service- und Vertriebsbüros finden Sie unter **www.boschrexroth.com** – einige Angaben in dieser Dokumentation können inzwischen überholt sein.

Außerhalb Deutschlands nehmen Sie bitte zuerst Kontakt mit Ihrem lokalen Ansprechpartner auf.

- Verkaufsniederlassungen
- Niederlassungen mit Kundendienst

Additional notes about service, repairs and training as well as the **actual** addresses of our sales- and service facilities are available on the Internet at **www.boschrexroth.com** – some information in this documentation may meanwhile be obsolete.

Please contact the sales & service offices in your area first.

- sales agencies
- offices providing service

9.4 Vor der Kontaktaufnahme... - Before contacting us...

Wir können Ihnen schnell und effizient helfen wenn Sie folgende Informationen bereithalten:

detaillierte Beschreibung der Störung und der Umstände.

Angaben auf dem Typenschild der betreffenden Produkte, insbesondere Typenschlüssel und Seriennummern.

Tel./Faxnummern und e-Mail-Adresse, unter denen Sie für Rückfragen zu erreichen sind.

For quick and efficient help, please have the following information ready:

1. Detailed description of the failure and circumstances.
2. Information on the nameplate of the affected products, especially typecodes and serial numbers.
3. Your phone/fax numbers and e-mail address, so we can contact you in case of questions.

9.5 Kundenbetreuungsstellen - Sales & Service Facilities

Deutschland – Germany

vom Ausland:
from abroad:

(0) nach Landeskennziffer weglassen!
don't dial (0) after country code!

Vertriebsgebiet Mitte Germany Centre	SERVICE	SERVICE	SERVICE
Bosch Rexroth AG Bgm.-Dr.-Nebel-Str. 2 97816 Lohr am Main Kompetenz-Zentrum Europa Tel.: +49 (0)9352 40-0 Fax: +49 (0)9352 40-4885	CALL ENTRY CENTER MO – FR von 07:00 - 18:00 Uhr from 7 am – 6 pm Tel. +49 (0) 9352 40 50 60 service@boschrexroth.de	HOTLINE MO – FR von 17:00 - 07:00 Uhr from 5 pm - 7 am + SA / SO Tel.: +49 (0)172 660 04 06 oder / or Tel.: +49 (0)171 333 88 26	ERSATZTEILE / SPARES verlängerte Ansprechzeit - extended office time - ♦ nur an Werktagen - only on working days - ♦ von 07:00 - 18:00 Uhr - from 7 am - 6 pm - Tel. +49 (0) 9352 40 42 22
Vertriebsgebiet Süd Germany South	Gebiet Südwest Germany South-West	Vertriebsgebiet Ost Germany East	Vertriebsgebiet Ost Germany East
Bosch Rexroth AG Landshuter Allee 8-10 80637 München Tel.: +49 (0)89 127 14-0 Fax: +49 (0)89 127 14-490	Bosch Rexroth AG Vertrieb Deutschland – VD-BI Geschäftsbereich Regionalzentrum Südwest Ringstrasse 70 / Postfach 1144 70736 Fellbach / 70701 Fellbach Tel.: +49 (0)711 57 61–100 Fax: +49 (0)711 57 61–125	Bosch Rexroth AG Beckerstraße 31 09120 Chemnitz Tel.: +49 (0)371 35 55-0 Fax: +49 (0)371 35 55-333	Bosch Rexroth AG Regionalzentrum Ost Walter-Köhn-Str. 4d 04356 Leipzig Tel.: +49 (0)341 25 61-0 Fax: +49 (0)341 25 61-111
Vertriebsgebiet West Germany West	Vertriebsgebiet Mitte Germany Centre	Vertriebsgebiet Nord Germany North	Vertriebsgebiet Nord Germany North
Bosch Rexroth AG Vertrieb Deutschland Regionalzentrum West Borsigstrasse 15 40880 Ratingen Tel.: +49 (0)2102 409-0 Fax: +49 (0)2102 409-406	Bosch Rexroth AG Regionalzentrum Mitte Waldecker Straße 13 64546 Mörfelden-Walldorf Tel.: +49 (0) 61 05 702-3 Fax: +49 (0) 61 05 702-444	Bosch Rexroth AG Walsroder Str. 93 30853 Langenhagen Tel.: +49 (0) 511 72 66 57-0 Fax: +49 (0) 511 72 66 57-95	Bosch Rexroth AG Kieler Straße 212 22525 Hamburg Tel.: +49 (0) 40 81 955 966 Fax: +49 (0) 40 85 418 978

Europa (West) - Europe (West)

vom Ausland: (0) nach Landeskennziffer weglassen, **Italien:** 0 nach Landeskennziffer mitwählen
from abroad: don't dial (0) after country code, **Italy:** dial 0 after country code

<p>Austria - Österreich</p> <p>Bosch Rexroth AG Stachegasse 13 1120 Wien</p> <p>Tel.: +43 (0)1 985 25 40 Fax: +43 (0)1 985 25 40-93</p>	<p>Austria – Österreich</p> <p>Bosch Rexroth AG Industriepark 18 4061 Pasching</p> <p>Tel.: +43 (0)7221 605-0 Fax: +43 (0)7221 605-21</p>	<p>Belgium - Belgien</p> <p>Bosch Rexroth AG Electric Drives & Controls Industrielaan 8 1740 Ternat</p> <p>Tel.: +32 (0)2 5830719 Service: +32 (0)2 5830717 Fax: +32 (0)2 5830731 indramat@boschrexroth.be</p>	<p>Denmark - Dänemark</p> <p>Bosch Rexroth A/S Zinkvej 6 8900 Randers</p> <p>Tel.: +45 (0)87 11 90 60 Fax: +45 (0)87 11 90 61</p>
<p>Great Britain – Großbritannien</p> <p>Bosch Rexroth Ltd. Broadway Lane, South Cerney Cirencester, Glos GL7 5UH</p> <p>Tel.: +44 (0)1285 863000 Fax: +44 (0)1285 863030 sales@boschrexroth.co.uk service@boschrexroth.co.uk</p>	<p>Finland - Finnland</p> <p>Rexroth Mecman Oy Ansatie 6 017 40 Vantaa</p> <p>Tel.: +358 (0)9 84 91-11 Fax: +358 (0)9 84 91-13 60</p>	<p>France - Frankreich</p> <p>Bosch Rexroth S.A. Avenue de la Trentaine BP. 74 77503 CHELLES CEDEX</p> <p>Tel.: +33 (0)164 72-70 00 Fax: +33 (0)164 72-63 00 Hotline: +33 (0)608 33 43 28</p>	<p>France - Frankreich</p> <p>Bosch Rexroth S.A. 1270, Avenue de Lardenne 31100 Toulouse</p> <p>Tel.: +33 (0)5 61 49 95 19 Fax: +33 (0)5 61 31 00 41</p>
<p>France - Frankreich</p> <p>Bosch Rexroth S.A. 91, Bd. Irène Joliot-Curie 69634 Vénissieux – Cedex</p> <p>Tel.: +33 (0)4 78 78 53 65 Fax: +33 (0)4 78 78 53 62</p>	<p>Italy - Italien</p> <p>Bosch Rexroth S.p.A. Via G. Di Vittoria, 1 20063 Cernusco S/N.MI</p> <p>Tel.: +39 02 2 365 270 Fax: +39 02 700 408 252378</p>	<p>Italy - Italien</p> <p>Bosch Rexroth S.p.A. Via Paolo Veronesi, 250 10148 Torino</p> <p>Tel.: +39 011 224 88 11 Fax: +39 011 220 48 04</p>	<p>Italy - Italien</p> <p>Bosch Rexroth S.p.A. Via del Progresso, 16 (Zona Ind.) 35020 Padova</p> <p>Tel.: +39 049 8 70 13 70 Fax: +39 049 8 70 13 77</p>
<p>Italy - Italien</p> <p>Bosch Rexroth S.p.A. Via Mascia, 1 80053 Castellammare di Stabia NA</p> <p>Tel.: +39 081 8 71 57 00 Fax: +39 081 8 71 68 85</p>	<p>Italy - Italien</p> <p>Bosch Rexroth S.p.A. Viale Oriani, 38/A 40137 Bologna</p> <p>Tel.: +39 051 34 14 14 Fax: +39 051 34 14 22</p>	<p>Netherlands - Niederlande/Holland</p> <p>Bosch Rexroth B.V. Kruisbroeksestraat 1 (P.O. Box 32) 5281 RV Boxtel</p> <p>Tel.: +31 (0)411 65 19 51 Fax: +31 (0)411 65 14 83 indramat@hydraudyne.nl</p>	<p>Netherlands - Niederlande/Holland</p> <p>Bosch Rexroth Services B.V. Kruisbroeksestraat 1 (P.O. Box 32) 5281 RV Boxtel</p> <p>Tel.: +31 (0)411 65 19 51 Fax: +31 (0)411 67 78 14</p>
<p>Norway - Norwegen</p> <p>Bosch Rexroth AS Berghagan 1 or: Box 3007 1405 Ski-Langhus 1402 Ski</p> <p>Tel.: +47 (0)64 86 41 00 Fax: +47 (0)64 86 90 62 jul.ruud@rexroth.no</p>	<p>Spain - Spanien</p> <p>Bosch Rexroth S.A. Centro Industrial Santiga Obradors s/n 08130 Santa Perpetua de Mogoda Barcelona</p> <p>Tel.: +34 9 37 47 94 00 Fax: +34 9 37 47 94 01</p>	<p>Spain - Spanien</p> <p>Bosch Rexroth S.A. Goimendi S.A. Parque Empresarial Zuatzu C/ Francisco Grandmontagne no.2 20018 San Sebastian</p> <p>Tel.: +34 9 43 31 84 21 - service: +34 9 43 31 84 56 Fax: +34 9 43 31 84 27 - service: +34 9 43 31 84 60 satindramat-goimendi@adeqi.es</p>	<p>Sweden - Schweden</p> <p>Rexroth Mecman Svenska AB Varuvägen 7 125 81 Stockholm</p> <p>Tel.: +46 (0)8 727 92 00 Fax: +46 (0)8 647 32 77</p>
<p>Sweden - Schweden</p> <p>Rexroth Mecman Svenska AB Ekvåndan 7 254 67 Helsingborg</p> <p>Tel.: +46 (0) 42 38 88 -50 Fax: +46 (0) 42 38 88 -74</p>	<p>Switzerland West - Schweiz West</p> <p>Bosch Rexroth Suisse SA Rue du village 1 1020 Renens</p> <p>Tel.: +41 (0)21 632 84 20 Fax: +41 (0)21 632 84 21</p>	<p>Switzerland East - Schweiz Ost</p> <p>Bosch Rexroth Schweiz AG Hemrietstrasse 2 8863 Buttikon</p> <p>Tel. +41 (0) 55 46 46 205 Fax +41 (0) 55 46 46 222</p>	

Europa (Ost) - Europe (East)

vom Ausland: (0) nach Landeskenziffer weglassen
from abroad: don't dial (0) after country code

Czech Republic - Tschechien Bosch -Rexroth, spol.s.r.o. Hviezdoslavova 5 627 00 Brno Tel.: +420 (0)5 48 126 358 Fax: +420 (0)5 48 126 112	Czech Republic - Tschechien DEL a.s. Strojirenská 38 Zdar nad Sázavou 591 01 Czech republic Tel.: +420 616 64 3144 Fax: +420 616 216 57	Hungary - Ungarn Bosch Rexroth Kft. Angol utca 34 1149 Budapest Tel.: +36 (1) 364 00 02 Fax: +36 (1) 383 19 80	Poland – Polen Bosch Rexroth Sp.zo.o. Biuro Poznan ul. Dabrowskiego 81/85 60-529 Poznan Tel.: +48 061 847 64 62 /-63 Fax: +48 061 847 64 02
Rumania - Rumänien Bosch Rexroth Sp.zo.o. Str. Drobety nr. 4-10, app. 14 70258 Bucuresti, Sector 2 Tel.: +40 (0)1 210 48 25 +40 (0)1 210 29 50 Fax: +40 (0)1 210 29 52	Russia - Russland Bosch Rexroth Wolokolamskoje Chaussee 73 Zimmer 406, 408 RUS – 123424 Moskau Tel.: +7 095/ 232 08 34 +7 095/ 232 08 35 Fax: +7 095/ 232 08 36 info.rex@rexroth.ru	Russia - Russland ELMIS 10, Internationalnaya Str. 246640 Gomel, Belarus Tel.: +375/ 232 53 42 70 Fax: +375/ 232 53 37 69 elmis_ltd@yahoo.com	Turkey - Türkei Bosch Rexroth Otomasyon San & Tic. A.S. Fevzi Cakmak Cad No. 3 34630 Sefaköy Istanbul Tel.: +90 212 541 60 70 Fax: +90 212 599 34 07
Slovenia - Slowenien DOMEL Otoki 21 64 228 Zelezniki Tel.: +386 5 5117 152 Fax: +386 5 5117 225 brane.ozebek@domel.si			

Africa, Asia, Australia – incl. Pacific Rim

vom Ausland: (0) nach Landeskenziffer weglassen!
from abroad: don't dial (0) after country code!

<p>Australia - Australien</p> <p>AIMS - Australian Industrial Machinery Services Pty. Ltd. Unit 3/45 Horne ST Campbellfield , VIC 3061 Melbourne Tel.: +61 (0) 393 590 228 Fax: +61 (0) 393 590 286 Hotline: +61 (0) 419 369 195 terryobrien@aimservices.com.au</p>	<p>Australia - Australien</p> <p>Bosch Rexroth Pty. Ltd. No. 7, Endeavour Way Braeside Victoria, 31 95 Melbourne Tel.: +61 (0)3 95 80 39 33 Fax: +61 (0)3 95 80 17 33 mel@rexroth.com.au</p>	<p>China</p> <p>Bosch Rexroth Ltd. Wai Gaoqiao Free Trade Zone No.122, Fu Te Dong Yi Road Shanghai 200131 - P.R.China Tel.: +86 21 58 66 30 30 Fax: +86 21 58 66 55 23 roger.shi_sh@boschrexroth.com.cn</p>	<p>China</p> <p>Bosch Rexroth (China) Ltd. 15/F China World Trade Center 1, Jianguomenwai Avenue Beijing 100004, P.R.China Tel.: +86 10 65 05 03 80 Fax: +86 10 65 05 03 79</p>
<p>China</p> <p>Bosch Rexroth (China) Ltd. A-5F., 123 Lian Shan Street Sha He Kou District Dalian 116 023, P.R.China Tel.: +86 411 46 78 930 Fax: +86 411 46 78 932</p>	<p>China</p> <p>Bosch Rexroth (Changzhou) Co.Ltd. Guangzhou Repres. Office Room 1014-1016, Metro Plaza, Tian He District, 183 Tian He Bei Rd Guangzhou 510075, P.R.China Tel.: +86 20 8755-0030 +86 20 8755-0011 Fax: +86 20 8755-2387</p>	<p>Hongkong</p> <p>Bosch Rexroth (China) Ltd. 6th Floor, Yeung Yiu Chung No.6 Ind Bldg. 19 Cheung Shun Street Cheung Sha Wan, Kowloon, Hongkong Tel.: +852 22 62 51 00 Fax: +852 27 41 33 44 alexis.siu@boschrexroth.com.hk</p>	<p>India - Indien</p> <p>Bosch Rexroth (India) Ltd. Plot. A-58, TTC Industrial Area Thane Turbhe Midc Road Mahape Village Navi Mumbai - 400 701 Tel.: +91 (0)22 7 61 46 22 Fax: +91 (0)22 7 68 15 31</p>
<p>India - Indien</p> <p>Bosch Rexroth (India) Ltd. Plot. 96, Phase III Peenya Industrial Area Bangalore - 560058 Tel.: +91 (0)80 8 39 73 74 Fax: +91 (0)80 8 39 43 45</p>	<p>Indonesia - Indonesien</p> <p>PT. Rexroth Wijayakusuma Building # 202, Cilandak Commercial Estate Jl. Cilandak KKO, Jakarta 12560 Tel.: +62 21 7891169 (5 lines) Fax: +62 21 7891170 - 71</p>	<p>Japan</p> <p>Bosch Rexroth Automation Corp. Service Center Japan Yutakagaoka 1810, Meito-ku, NAGOYA 465-0035, Japan Tel.: +81 (0)52 777 88 41 +81 (0)52 777 88 53 +81 (0)52 777 88 79 Fax: +81 (0)52 777 89 01</p>	<p>Japan</p> <p>Bosch Rexroth Automation Corp. 1F, I.R. Building Nakamachidai 4-26-44, Tsuzuki-ku YOKOHAMA 224-0041, Japan Tel.: +81 (0)45 942 72 10 Fax: +81 (0)45 942 03 41</p>
<p>Korea</p> <p>Bosch Rexroth-Korea Ltd. 1515-14 Dadae-Dong, Saha-Ku Pusan Metropolitan City, 604-050 Republic of South Korea Tel.: +82 (0)51 26 00 741 Fax: +82 (0)51 26 00 747 gyhan@rexrothkorea.co.kr</p>	<p>Malaysia</p> <p>Bosch Rexroth Sdn.Bhd. Head Office No. 3, Block B, Jalan SS 13/5 Subang Jaya Industrial Estate 47500 Petaling Jaya - Selangor Tel.: +60 (0) 3 73 44 870 Fax: +60 (0) 3 73 44 864 hockhwa@hotmail.com</p>	<p>Singapore - Singapur</p> <p>Robert Bosch (SEA) Pte Ltd. Dept. RBSI-R/SAT 38-C Jalan Pemimpin Singapore 577180 Tel.: +65 35 05 470 Fax: +65 35 05 313 kenton.peh@sg.bosch.com</p>	<p>South Africa - Südafrika</p> <p>TECTRA Automation (Pty) Ltd. 28 Banfield Road, Industria North RSA - Maraisburg 1700 Tel.: +27 (0)11 673 20 80 Fax: +27 (0)11 673 72 69 Hotline: +27 (0)82 903 29 23 georgv@tectra.co.za</p>
<p>Taiwan</p> <p>Rexroth Uchida Co., Ltd. No.17, Lane 136, Cheng Bei 1 Rd., Yung Kang, Tainan Hsien Taiwan, R.O.C. Tel.: +886 (0)6 25 36 565 Fax: +886 (0)6 25 34 754 indramat@mail.net.tw</p>	<p>Thailand</p> <p>NC Advance Technology Co. Ltd. 59/76 Moo 9 Ramintra road 34 Tharang, Bangkhen, Bangkok 10230 Tel.: +66 2 943 70 62 +66 2 943 71 21 Fax: +66 2 509 23 62 sonkawin@hotmail.com</p>		

Nordamerika – North America

USA Hauptniederlassung - Headquarters Bosch Rexroth Corporation Electric Drives and Controls 5150 Prairie Stone Parkway Hoffman Estates, IL 60192-3707 Tel.: +1 847 6 45 36 00 Fax: +1 847 6 45 62 01 service@boschrexroth.com	USA Central Region - Mitte Bosch Rexroth Corporation Electric Drives and Controls 1701 Harmon Road Central Region Technical Center Auburn Hills, MI 48326 Tel.: +1 248 3 93 33 30 Fax: +1 248 3 93 29 06	USA Southeast Region - Südwest Bosch Rexroth Corporation Electric Drives and Controls Southeastern Technical Center 3625 Swiftwater Park Drive Suwanee, Georgia 30124 Tel.: +1 770 9 32 32 00 Fax: +1 770 9 32 19 03	USA SERVICE-HOTLINE - 7 days x 24hrs - +1-800-860-1055
USA East Region –Ost Bosch Rexroth Corporation Electric Drives and Controls Charlotte Regional Sales Office 14001 South Lakes Drive Charlotte, North Carolina 28273 Tel.: +1 704 5 83 97 62 +1 704 5 83 14 86	USA Northeast Region – Nordost Bosch Rexroth Corporation Electric Drives and Controls Northeastern Technical Center 99 Rainbow Road East Granby, Connecticut 06026 Tel.: +1 860 8 44 83 77 Fax: +1 860 8 44 85 95	USA West Region – West Bosch Rexroth Corporation 7901 Stoneridge Drive, Suite 220 Pleasant Hill, California 94588 Tel.: +1 925 227 10 84 Fax: +1 925 227 10 81	
Canada East - Kanada Ost Bosch Rexroth Canada Corporation Burlington Division 3426 Mainway Drive Burlington, Ontario Canada L7M 1A8 Tel.: +1 905 335 55 11 Fax: +1 905 335-41 84 michael.moro@boschrexroth.ca	Canada West - Kanada West Bosch Rexroth Canada Corporation 5345 Goring St. Burnaby, British Columbia Canada V7J 1R1 Tel. +1 604 205-5777 Fax +1 604 205-6944 david.gunby@boschrexroth.ca	Mexico Bosch Rexroth S.A. de C.V. Calle Neptuno 72 Unidad Ind. Vallejo MEX - 07700 Mexico, D.F. Tel.: +52 5 754 17 11 +52 5 754 36 84 +52 5 754 12 60 Fax: +52 5 754 50 73 +52 5 752 59 43	

Südamerika – South America

Argentina - Argentinien Bosch Rexroth S.A.I.C. "The Drive & Control Company" Acassusso 48 41/47 1605 Munro Prov. Buenos Aires Tel.: +54 (0)11 4756 01 40 Fax: +54 (0)11 4756 01 36 mannesmann@mannesmannsaic.com.ar	Argentina - Argentinien NAKASE Servicio Tecnico CNC Calle 49, No. 5764/66 1653 Villa Balester Prov. - Buenos Aires Tel.: +54 (0) 11 4768 36 43 Fax: +54 (0) 11 4768 24 13 nakase@usa.net nakase@nakase.com	Brazil - Brasilien Bosch Rexroth Ltda. Av. Tégula, 888 Ponte Alta, Atibaia SP CEP 12942-440 Tel.: +55 (0)11 4414 56 92 +55 (0)11 4414 56 84 Fax sales: +55 (0)11 4414 57 07 Fax serv.: +55 (0)11 4414 56 86 alexandre.wittwer@rexroth.com.br	Brazil - Brasilien Bosch Rexroth Ltda. R. Dr.Humberto Pinheiro Vieira, 100 Distrito Industrial [Caixa Postal 1273] BR - 89220-390 Joinville - SC Tel./Fax: +55 (0)47 473 58 33 Mobil: +55 (0)47 9974 6645 prochnow@zaz.com.br
Columbia - Kolumbien Refflutec de Colombia Ltda. Calle 37 No. 22-31 Santafé de Bogotá, D.C. Colombia Tel.: +57 1 368 82 67 +57 1 368 02 59 Fax: +57 1 268 97 37 reflutec@inter.net.co			



Printed in the U.S.A.

Rexroth
Bosch Group